

# WB.16.02.0025 Release Notes

**aruba**

a Hewlett Packard  
Enterprise company

Part Number: 5200-5102  
Published: July 2018  
Edition: 1

© Copyright 2018 Hewlett Packard Enterprise Development LP

## Notices

The information contained herein is subject to change without notice. The only warranties for Hewlett Packard Enterprise products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. Hewlett Packard Enterprise shall not be liable for technical or editorial errors or omissions contained herein.

Confidential computer software. Valid license from Hewlett Packard Enterprise required for possession, use, or copying. Consistent with FAR 12.211 and 12.212, Commercial Computer Software, Computer Software Documentation, and Technical Data for Commercial Items are licensed to the U.S. Government under vendor's standard commercial license.

Links to third-party websites take you outside the Hewlett Packard Enterprise website. Hewlett Packard Enterprise has no control over and is not responsible for information outside the Hewlett Packard Enterprise website.

## Acknowledgments

Microsoft® and Windows® are either registered trademarks or trademarks of Microsoft Corporation in the United States and/or other countries.

<b>Chapter 1 16.02.0025 Release Notes</b> .....	<b>7</b>
Description.....	7
Important information.....	7
Version history.....	7
Products supported.....	9
Compatibility/interoperability.....	9
Minimum supported software versions.....	10
Enhancements.....	10
Version 16.02.0025.....	10
Multicast Listener Discovery (MLD).....	10
RMON.....	10
Version 16.02.0024.....	10
Version 16.02.0023m.....	10
Version 16.02.0022m.....	10
Version 16.02.0021.....	10
Version 16.02.0020.....	10
Version 16.02.0019.....	11
Version 16.02.0018.....	11
Cable Diagnostics.....	11
IPsec Tunnel.....	11
IPsec VPN Type.....	11
REST ACL Rules.....	11
REST System Details.....	12
Version 16.02.0017.....	12
Version 16.02.0016.....	12
OpenFlow.....	12
VLAN.....	12
Version 16.02.0015.....	12
Federal Certification.....	12
Version 16.02.0014.....	12
IPSec.....	12
TCP Push Preserve.....	12
Version 16.02.0013.....	13
Version 16.02.0012.....	13
BootROM.....	13
Version 16.02.0011.....	13
Central - ACL configuration.....	13
Central - DHCP REST API [add, delete, and query].....	13
Central - Dot 1x/RADIUS REST.....	13
Central - LED blink for Central connection.....	13
MAS feature: LLDP Authentication bypass with AP.....	13
Tunneled Node enhancement: fallback to switching and CoA.....	13
Version 16.02.0010.....	13
Version 16.02.0009.....	14
BootROM.....	14
Version 16.02.0008.....	14
Add MTU to Device Profile.....	14
Add 'no CoS' to Device Profile.....	14
AirWave Management Platform (AMP) Server MIB Changes.....	14
Connection via Management VLAN.....	14

Instrumentation Enhancements	14
IP Service Level Agreement	15
IPsec for AirWave Connection	15
Local User Roles	15
MAC Authentication Toggle	16
Per Port Trust	16
Per Port Tunneled Node	16
User Policies	16
Username VSA support	17
ZTP for Activate	17
Fixes	17
Version 16.02.0025	17
ACLs	17
Classifier	17
Dynamic IP Lockdown	18
Front Panel Security	18
Job Scheduler	18
LLDP	18
Logging	18
Multicast	18
OSPF	19
REST	19
sFlow	19
SSH	19
Transceivers	19
User Roles	20
Version 16.02.0024	20
Version 16.02.0023m	20
Version 16.02.0022m	20
Authentication	20
Central	21
DHCP Snooping	21
Multicast	21
MVRP	21
PBR	21
Rogue AP Isolation	22
SNMP	22
SSH	22
VLAN	22
Version 16.02.0021	22
Authentication	22
PoE	23
Smart Link	23
SSH	23
Stacking	23
Version 16.02.0020	24
Console	24
LLDP	24
OpenFlow	24
OSPF	24
PoE	25
Private VLAN	25
RMON	25
sFlow	25
Smart Link	26
SSH	26
UDLD	26

Version 16.02.0019	26
Version 16.02.0018	27
CDP	27
CLI	27
Device Profile	27
DHCP Snooping	27
Direct Attach Cables	27
Fault Finder	27
IGMP	28
MAC Authentication	28
Mirroring	28
OOBM	28
OSPF	29
PoE	29
QoS	29
Routing	29
Spanning Tree	30
Switch Module	30
Syslog	30
Web UI	30
Version 16.02.0017	31
Version 16.02.0016	31
Authentication	31
Banner	31
Cable Diagnostic	31
DHCP	31
DHCP Server	32
Event Log	32
Job Scheduler	32
OpenFlow	32
SNMP	33
Spanning Tree	33
Stacking	33
Terminal	34
Trunking	34
Tunneling	34
Version 16.02.0015	34
Version 16.02.0014	34
Authorization	34
Console	35
IPsec	35
MAC Authentication	35
mDNS	35
OOBM	36
OpenFlow	36
SNMP	36
SSH	36
Trunking	37
Web UI	37
Version 16.02.0013	37
Version 16.02.0012	37
IGMP	37
Version 16.02.0011	37
GVRP	37
IP Tunnels	38
MAC Authentication	38
OpenFlow	38

Redundancy.....	38
Transceivers.....	38
Version 16.02.0010.....	38
Stacking.....	38
Version 16.02.0009.....	39
Aruba Management Software.....	39
Trunking.....	39
Version 16.02.0008.....	39
Banner.....	39
CLI.....	39
Console.....	39
Counters.....	40
CPPM.....	40
DHCP.....	40
Display Issue.....	40
File Transfer.....	40
GVRP.....	40
IGMP.....	41
IPv6 ND.....	41
MAC-Based VLANs.....	41
Menu.....	41
NTP.....	42
OOBM.....	42
OpenFlow.....	42
PoE.....	42
SNMP.....	42
Spanning Tree.....	43
Supportability.....	43
Switch Module.....	43
Trunking.....	43
Upgrade information.....	43

## **Chapter 2 Hewlett Packard Enterprise security policy..... 45**

Finding Security Bulletins.....	45
Security Bulletin subscription service.....	45

## **Chapter 3 Websites..... 46**

## **Chapter 4 Support and other resources..... 47**

Accessing Hewlett Packard Enterprise Support.....	47
Accessing updates.....	47
Customer self repair.....	48
Remote support.....	48
Warranty information.....	48
Regulatory information.....	49
Documentation feedback.....	49

## Description

This release note covers software versions for the WB.16.02 branch of the software.

Version WB.16.02.0008 was the initial build of Major version WB.16.02 software. WB.16.02.0008 includes all enhancements and fixes in the WB.16.01.0004 software, plus the additional enhancements and fixes in the WB.16.02.0008 enhancements and fixes sections of this release note.

Product series supported by this software:

Aruba 2920 Switch Series

## Important information

To avoid damage to your equipment, do not interrupt power to the switch during a software update.

To enable ZTP for Activate in switches that are updated to 16.02.0010 or later from a version previous to 16.02.0010, the switches have to be reset to factory default (see the *Installation and Getting Started Guide* for your switch for details on resetting the switch). For switches that come from the factory with 16.02.0012 or later installed, ZTP for Activate is enabled by default. To disable ZTP for Activate, see the *Management and Configuration Guide* for your switch.

Firmware downgrade to a version earlier than 16.01 is not allowed if the max-vlans value is greater than 2048.

Unconfigure the max-vlans before attempting to downgrade from WB.16.02.0008 or later to a version earlier than 16.01 of the firmware.

For information on best practices when updating software or rolling back to previous versions of software, see the "Best practices for software updates" section of the *HPE ArubaOS-Switch Basic Operations Guide Version 16.02*.

## Version history

All released versions are fully supported by Hewlett Packard Enterprise, unless noted in the table.

Version number	Release date	Based on	Remarks
WB.16.02.0025	2018-06-22	WB.16.02.0024	Released, fully supported, and posted on the web.
WB.16.02.0024	n/a	WB.16.02.0023m	Never released.
WB.16.02.0023m	n/a	WB.16.02.0022m	Never released.
WB.16.02.0022m	2017-12-22	WB.16.02.0021	Released, fully supported, and posted on the web.
WB.16.02.0021	2017-09-15	WB.16.02.0020	Released, fully supported, and posted on the web.
WB.16.02.0020	2017-07-07	WB.16.02.0019	Released, fully supported, and posted on the web.

*Table Continued*

Version number	Release date	Based on	Remarks
WB.16.02.0019	n/a	WB.16.02.0018	Never released.
WB.16.02.0018	2017-03-31	WB.16.02.0017	Released, fully supported, and posted on the web.
WB.16.02.0017	n/a	WB.16.02.0016	Never released.
WB.16.02.0016	2017-01-27	WB.16.02.0015	Released, fully supported, and posted on the web.
WB.16.02.0015	2016-12-21	WB.16.02.0014	Released, fully supported, and posted on the web.
WB.16.02.0014	2016-10-28	WB.16.02.0013	Released, fully supported, and posted on the web.
WB.16.02.0013	n/a	WB.16.02.0012	Never released.
WB.16.02.0012	2016-08-31	WB.16.02.0011	Released, fully supported, and posted on the web.
WB.16.02.0011	2016-08-24	WB.16.02.0010	Released, fully supported, and posted on the web.
WB.16.02.0010	2016-08-11	WB.16.02.0009	Released, fully supported, and posted on the web.
WB.16.02.0009	n/a	WB.16.02.0008	Never released.
WB.16.02.0008	2016-07-08	WB.16.01.0004	Initial release of the WB.16.02 branch. Released, fully supported, and posted on the web.
WB.16.01.0008	2016-08-02	WB.16.01.0007	Please see the WB.16.01.0008 release notes for detailed information on the WB.16.01 branch. Released, fully supported, and posted on the web.
WB.16.01.0007	2016-05-31	WB.16.01.0006	Released, fully supported, and posted on the web.
WB.16.01.0006	2016-03-28	WB.16.01.0005	Released, fully supported, and posted on the web.
WB.16.01.0005	n/a	WB.16.01.0004	Never released.
WB.16.01.0004	2016-01-20	WB.15.18.0007	Initial release of the WB.16.01 branch.
WB.15.18.0012	2016-08-02	WB.15.18.0011	Please see the WB.15.18.0012 release notes for detailed information on the WB.15.18 branch. Released, fully supported, and posted on the web.
WB.15.18.0011	2016-05-31	WB.15.18.0010	Released, fully supported, and posted on the web.
WB.15.18.0010	2016-03-28	WB.15.18.0009	Released, fully supported, and posted on the web.

*Table Continued*



Version number	Release date	Based on	Remarks
WB.15.18.0009	n/a	WB.15.18.0008	Never released.
WB.15.18.0008	2016-01-19	WB.15.18.0007	Released, fully supported, and posted on the web.
WB.15.18.0007	2015-11-10	WB.15.18.0006	Released, fully supported, and posted on the web.
WB.15.18.0006	2015-08-15	WB.15.17.0003	Initial release of the WB.15.18 branch. Released, fully supported, and posted on the web.

## Products supported

This release applies to the following product models:

Product number	Description
J9726A	Aruba 2920 24G Switch
J9728A	Aruba 2920 48G Switch
J9727A	Aruba 2920 24G PoE+ Switch
J9729A	Aruba 2920 48G PoE+ Switch
J9836A	Aruba 2920 48G PoE+ 740W Switch

## Compatibility/interoperability

The switch web agent supports the following web browsers:

Browser	Supported versions
Internet Explorer	<ul style="list-style-type: none"> <li>• Edge</li> <li>• 11</li> </ul>
Chrome	<ul style="list-style-type: none"> <li>• 53</li> <li>• 52</li> </ul>
Firefox	<ul style="list-style-type: none"> <li>• 49</li> <li>• 48</li> </ul>
Safari (MacOS only)	<ul style="list-style-type: none"> <li>• 10</li> <li>• 9</li> </ul>



**NOTE:** HPE recommends using the most recent version of each browser as of the date of this release note.

## Minimum supported software versions



**NOTE:** If your switch or module is not listed in the below table, it runs on all versions of the software.

Product number	Product name	Minimum software version
J9805A	HPE 640 Redundant/External PS Shelf	WB.15.13.0003

For information on networking application compatibility, see the *HPE ArubaOS-Switch Software Feature Support Matrix*.

## Enhancements

This section lists enhancements added to this branch of the software.

Software enhancements are listed in reverse-chronological order, with the newest on the top of the list. Unless otherwise noted, each software version listed includes all enhancements added in earlier versions.

### Version 16.02.0025

#### Multicast Listener Discovery (MLD)

Added new "link-local" option for MLD `show` commands to display well-known multicast group addresses.

```
show ipv6 mld link-local
```

#### RMON

Support for system buffers to log an RMON event similar to `buffer allocation has reached xx%`, whenever the buffer usage exceeds a certain threshold.

### Version 16.02.0024

Version 16.02.0024 was never released.

### Version 16.02.0023m

Version 16.02.0023m was never released.

### Version 16.02.0022m

No enhancements were included in version 16.02.0022m.

### Version 16.02.0021

No enhancements were included in version 16.02.0021.

### Version 16.02.0020

No enhancements were included in version 16.02.0020.

## Version 16.02.0019

Version 16.02.0019 was never released.

## Version 16.02.0018

### Cable Diagnostics

Added support for cable diagnostics to detect faults in 1G copper cable. This feature supports detection for distance to fault on a good cable. The feature can be used via CLI command `test cable-diagnostic`.

When the command is run, the following message is presented:

```
This command will cause a loss of link on all tested ports and will take several
seconds per port to complete. Use the 'show cable-diagnostics' command to view the
results.
Continue (y/n)?
```

### IPsec Tunnel

Support for creating an IPsec tunnel between the switch and the Aruba mobility controller acting as a VPN concentrator has been added. This functionality allows the creation of a secure channel for communication between the switch and certain services such as Airwave, ClearPass, Syslog, and DNS. The ability to set routes to multiple destinations through the IPsec tunnel, as well as a default gateway route from the switch to the controller for non-IPsec traffic, is now possible.

The CLI command `aruba <vpn-type> peer-ip` initiates the IPsec session with the controller. The `<vpn-type>` can be either `amp` or `any`. If type `amp` is used, the switch will perform ZTP by triggering check-in (to Airwave) through the IPsec channel. If type `any` is used, the switch will not automatically add a route to Airwave IP through the tunnel.

To configure Routes (to services behind the Aruba VPN Controller, such as CPPM, Syslog, DNS, etc.) through the IPsec channel use the CLI command `ip route /mask interface tunnel aruba-vpn`. Before adding/deleting a route to service network through the IPsec tunnel, it is recommended to execute the following CLI commands in case the controller IP also belongs to service network. These commands add/delete a static route to reach the controller IP through the default gateway:

```
aruba-vpn default-gateway enable
aruba-vpn default-gateway disable
```

### IPsec VPN Type

Added a new `aruba-vpn type "any"` to enable control plane traffic protection for a Remote Access VPN session.

Example: `aruba-vpn type any`

When deleting an existing `aruba-vpn` configuration and before configuring with a new `aruba-vpn type`, a warning message is prompted: Remove the existing `aruba-vpn` configuration before configuring with a new `aruba vpn type`.

Switch software downgrade to a previous version is not allowed with Aruba VPN type "any" configured. An error message is displayed: Firmware downgrade is not allowed if `aruba vpn` is configured with type `any`. Please unconfigure it before attempting to downgrade.

### REST ACL Rules

Support for ICMP and IGMP protocols, ToS, precedence, and log options have been added to the REST API for ACL rules.

## REST System Details

Removed version dependency on displaying VLAN ID and IP address in REST interface for System Details. VLAN ID and assigned IP address of Aruba Central connection is now supported with REST v2.

## Version 16.02.0017

Version 16.02.0017 was never released.

## Version 16.02.0016

### OpenFlow

Added restriction warning message for trunk interface modifications when in use by OpenFlow:

```
Trunk in use by an OpenFlow instance may not be modified.
```

### VLAN

Switch design does not allow a port to be orphaned when it is removed from the port's last assigned VLAN. The port has to be manually re-assigned to any other existing VLAN to make sure the port is always assigned to a VLAN. If removing a port from its last VLAN, the port is now automatically untagged to the DEFAULT VLAN, eliminating the previous 2-step process - move port to another VLAN prior to removing the port's last assigned VLAN.

## Version 16.02.0015

### Federal Certification

Added improvements to the selftest and key validation for RSA and triple DES cryptographic algorithm implementations.

## Version 16.02.0014

### IPSec

**Symptom/Scenario:** Added multi-service support for Aruba VPN tunnel. To turn on one multiple service on the Aruba VPN tunnel, a separate targeted route to Controller through the default gateway needs to be added before adding a new service network route. This can be implemented using the following CLI commands:

1. Enable or disable default gateway support for Aruba VPN tunnel

```
aruba-vpn default-gateway [enable | disable]
```

2. Add or delete static route, identified by a destination (*ip-addr/mask-len*), to the Aruba VPN tunnel destination for that route

```
ip route <ip-addr/mask-len> tunnel aruba-vpn
```

### TCP Push Preserve

Starting with this build, the TCP Push Preserve mode is set to DISABLED by default.

The TCP Push Preserve mode determines the queuing of the TCP packets that have the PUSH flag set. When this mode is enabled and the egress queue is full, TCP packets with the PUSH flag set are queued at the head of the ingress queue for egress queue space. This may delay subsequent incoming packets in the same queue and

create a head-of-line blocking situation. When this mode is disabled and the egress queue is full, TCP packets with the PUSH flag set are dropped from the head of the ingress queue.

If the current switch TCP Push Preserve mode has been set to DISABLED, it will be preserved as DISABLED and the corresponding configuration entries will be suppressed. If the current switch TCP PUSH preserve mode has been set to ENABLED, it will be changed to DISABLED and the change will be noted in system event logs as `The tcp-push-preserve feature was disabled`. This is a change to default configuration.

The CLI command `show tcp-push-preserve` indicates the status of TCP push mode ENABLED/DISABLED. CLI command `[no] tcp-push-preserve` changes the status of TCP push mode.

## Version 16.02.0013

Version 16.02.0013 was never released.

## Version 16.02.0012

### BootROM

The BootROM version was updated to WB.16.03.

## Version 16.02.0011

### Central - ACL configuration

Added a new REST API to return all ACL rules. This enhancement must be enabled by Aruba Central.

### Central - DHCP REST API [add, delete, and query]

Added REST APIs for DHCP Server configuration. This enhancement must be enabled by Aruba Central.

### Central - Dot 1x/RADIUS REST

Added REST APIs for RADIUS configuration. This enhancement must be enabled by Aruba Central.

### Central - LED blink for Central connection

Central connectivity is visually indicated by LED's for Cloud customers who are going to use existing products. If the device is not connected to Central then LEDs will indicate the connection status (super state) which broken down into further substrate error. USR/FDX LED, Locator LED and Port Mode LED are used to indicate various states. Customer will press the mode button to enter USR/FDx mode then see the port mode LED behavior (if cloud enabled).

### MAS feature: LLDP Authentication bypass with AP

This feature by-passes authentication for an AP that sends LLDP TLV.

### Tunneled Node enhancement: fallback to switching and CoA

When tunneled node is enabled on a port and controller is not reachable, an option is added to continue to do local switching on the port traffic.

Once the tunnel is established to the controller, the port traffic is tunneled to the controller.

## Version 16.02.0010

No enhancements were included in version 16.02.0010.

## Version 16.02.0009

### BootROM

The BootROM version was updated to WB.16.02.

## Version 16.02.0008

### Add MTU to Device Profile

ArubaOS-Switch-based switches support the jumbo frame attribute in device profile. When an Aruba AP is attached to the port, the configured MTU is applied to the port.

The default size of the MTU is 9K. This value is not configurable through device profile context commands. If the user wants to change this value, they manually configure it in the switch global configuration. Users can enable or disable Jumbo frame support through device profile. By default, jumbo frame support is disabled.

If jumbo frame support is already enabled on a VLAN, but disabled in the device profile for the same VLAN, jumbo frame support will remain enabled even if the device profile is active. Non device-profile configuration takes precedence over device profile configuration.

When the user enables jumbo frame support, all the VLANs configured in the device profile will get jumbo frame enabled. All ports belonging to that VLAN can handle packets up to 9k size (default size). This includes ports where an Aruba AP is not connected if that port belongs to a VLAN configured in the device profile.

### Add 'no CoS' to Device Profile

Class of service (CoS) is applied on the packets received on the port. The default value is "none". If a user wants to change the CoS configuration, the user can set any CoS value from 0-7. Whenever the configured value is "none," the switch honors the CoS value of the packet. If the CoS value is set via the Device Profile, the CoS setting on the Device Profile is used instead.

**Please note:** In the 16.01 release, the CoS value could be set to any value from 0 to 7. From 16.02 onwards, the CoS value can be configured as "none" also.

The commands to set CoS value to "none" are:

```
(config)#device-profile name abc
(device-profile)#no cos
```

### AirWave Management Platform (AMP) Server MIB Changes

SNMP MIB support for AMP-Server and IPSec tunnel for AMP management traffic are available in 16.02.

### Connection via Management VLAN

When the Management VLAN is configured and enabled (active), connection to the AMP Server will be allowed only via Management VLAN.

### Instrumentation Enhancements

Provide additional/enhanced information that can assist in diagnostics, monitoring, and troubleshooting of various switch features.

- DT, STP, and LLDP `show tech` enhancements
- Multicast `show tech` enhancements

## IP Service Level Agreement

IP Service Level Agreement (IP SLA) is a feature that helps administrators collect information about network performance in real time. With increasing pressure on maintaining agreed-upon Service Level Agreements on Enterprises and ISPs alike, the IP SLA serves as a useful tool.

The IP SLA feature provides:

- Application-aware monitoring that simulates actual protocol packets.
- Predictable measures that aid in ease of deployment and help with assessment of existing network performance.
- Measures of delay and packet loss for time-sensitive applications.
- End-to-end measurements to represent actual user experience.

The following SLA types are supported:

- UDP Echo, including connectivity testing of transport layer (UDP) services, Round-Trip-Time (RTT) measurement, one-way delay, and packet loss details.
- ICMP Echo, including connectivity testing, RTT measurement, and packet loss details.
- TCP Connect, including connectivity testing of transport layer (TCP) services, and handshake time measurement.

## IPsec for AirWave Connection

Support for secure communication between ArubaOS-Switches and an Aruba mobility controller (VPN concentrator) for the management traffic sent to or received from the AirWave Management Platform (AMP) server.

This feature provides necessary support for Zero Touch Provisioning (ZTP) by establishing a secure channel between an ArubaOS-Switch-based switch and the Network Management Server (AirWave). ZTP is a feature by which switches discover their respective management system (AirWave or Aruba Central) during initial boot up using DHCP or Activate. This enables switches to be configured and managed automatically without admin intervention.

In a deployment scenario where a switch at a remote branch and an AirWave server located at corporate headquarters or datacenter are connected via an un-trusted public network (Internet), communication between the switch and the AirWave server must be protected. This feature ensures that communication between ArubaOS-Switch-based switches and an AirWave Server (management traffic) is protected by establishing a secure channel between the switches and an Aruba VPN Controller (connected to an AirWave server) using an IPsec tunnel for the management traffic between the AMP server and the switch.

**Please note:** This feature only works with the following ArubaOS-Switch-based switches as these switches fully support TPM certificates: 2920, 2930F, 3800, 3810, and 5400R. This feature is restricted to work only with an Aruba Controller (as VPN concentrator) for the IPsec tunnel between the switch and the AMP server.

This feature is currently supported only with Aruba Controller running ArubaOS 6.5.0.0.

## Local User Roles

When this feature is enabled, every authenticated client is associated with a user role (even when authentication fails), which determines the client's network privileges, frequency of re-authentication, VLAN, captive portal profile, rate-limit, and QoS (Quality of Service).

The feature is globally enabled for all authentication methods and does not impact clients connected to ports without port-security.

User Roles are locally created in an ArubaOS-Switch-based switch and applied based on a client's MAC Address for Local-MAC-Authentication or via the HPE-User-Role VSA (Vendor Specific Attribute) returned by the RADIUS server for MAC-Authentication, Web-Authentication, and 802.1X.

## MAC Authentication Toggle

Port-based MAC authentication allows an infrastructure device to be authenticated with a port-based policy that dictates the distribution switch to open the authenticator port to all clients from the authenticated device. This is similar to the existing port-based 802.1X authentication available on HPE switches, except that the new port-based 802.1X authentication can also be statically configured on an authenticator port to be persistent over port toggling and switch reboot, while the existing port-based mode MAC authentication will be dynamic, triggered by the dynamic policy an authenticated client will receive.

## Per Port Trust

The per-port Trust QoS feature allows customers to select which packet fields are used to determine inbound service-priority:

Packet fields	Description
Default	Use the VLAN cos (Priority Code Point, or PCP) value and preserve any IP-ToS values.
dot1p	Same as default mode.
ip-prec	Use the QoS value corresponding to the IP-Precedence priority-mapping for the IP-ToS field.
Dscp	Use the QoS value corresponding to the Differentiated Services priority-mapping for the IP-ToS field.
None	Use none of the inbound packet-priority information.

For details about the QoS Type-of-Service IP-Precedence or Differentiated-Services priority mappings, please refer to the *Advanced Traffic Management Guide* for your switch.

**Please note:** QoS trust modes other than “default” or “none” are **mutually exclusive** with the QoS port-priority feature.

## Per Port Tunneled Node

Tunneled node, also known as a wired tunneled node, provides access and security using an overlay architecture.

The tunneled node connects to one or more client devices at the edge of the network and then establishes an L2 GRE tunnel to the controlling concentrator server. This approach allows the controller to support all the centralized security features, such as 802.1X authentication, captive-portal authentication, and stateful firewall.

The Tunneled Node feature is enabled on a per-port basis. Any traffic coming from non-tunneled node interfaces will be forwarded “normally” without being tunneled to a Mobility Controller.

## User Policies

User Policies are new QoS (Quality of Service) Policies that are used in conjunction with User-Roles to provide control over ingress traffic originating from User-Role assigned clients. This feature supports IPv4 and IPv6 traffic. Classified user traffic is matched and shaped by user policy actions. User Policy actions allow traffic to be rate-limited, permitted, and denied. It also allows VLAN priority, DSCP, and IP-Precedence (DSCP & IP-precedence are mutually exclusive) to be assigned to matching traffic. User Policies are assigned to User-Roles.



## Username VSA support

This feature enables the 'Client Name' field on the switch to be updated with a value configured via the User-Name VSA (Vendor Specific Attribute) returned by the RADIUS server. This improves the data displayed via the Consolidated Client View output generated by the CLI command `show port-access client`, especially when using MAC-Authentication.

## ZTP for Activate

The Aruba Activate service is part of the larger Mobility as a Service (MaaS) cloud initiative from Aruba. The Aruba Activate service consists of many services like Tracking, Provisioning, Upgrade and Inventory. Due to a limitation in the Activate server, this feature is only available for switch units manufactured after February 1, 2016 (the 3rd and 4th letters in the serial number have to be 62 or higher).

Zero Touch Provisioning (ZTP) enables auto-configuration of an ArubaOS-Switch-based switch without requiring any admin intervention on the switch. When a Cloud-enabled ArubaOS-Switch-based switch with factory default configuration becomes active on the network, it first contacts the NTP server, then contacts the Activate server, where it gets validated and forwarded to a Central or AirWave server to start further communications for auto provisioning.

The Activate ZTP process:

- Redirects the switch to AirWave or Central. Activate is not responsible for the actual switch configuration.
- If Activate returns an Aruba Mobility Controller IP address (in addition to AirWave parameters), the switch establishes an IPsec tunnel with the Controller and sends traffic over this tunnel.

## Fixes

This section lists released builds that include fixes found in this branch of the software. Software fixes are listed in reverse-chronological order, with the newest on the top of the list. Unless otherwise noted, each software version listed includes all fixes added in earlier versions.

The Symptom statement describes what a user might experience if this is seen on the network. The Scenario statement provides additional environment details and trigger summaries. When available, the Workaround statement provides a workaround to the issue for customers who decide not to update to this version of software.



---

**NOTE:** The number that precedes the fix description is used for tracking purposes.

---

## Version 16.02.0025

### ACLs

#### CR\_0000244157

**Symptom:** The switch experiences a loss in available memory.

**Scenario:** When removing and re-applying IPv6 ACLs repeatedly, the switch free memory decreases.

### Classifier

#### CR\_0000244171

**Symptom:** The switch does not display certain traffic classes.

**Scenario:** If a traffic class name includes reserved words, such as "remark", the switch does not display the statistics for the respective class name in the output of the `show statistics policy <POLICY-ID>` command.

**Workaround:** Avoid using reserved words when configuring traffic class names.

## Dynamic IP Lockdown CR\_0000240248

**Symptom:** The switch incorrectly blocks traffic.

**Scenario:** When the switch is configured with dynamic IP lockdown on a switch interface, it may incorrectly block traffic on that interface after a switch reboot.

**Workaround:** Clearing switch ARP cache resolves the issue until the next switch reboot.

## Front Panel Security CR\_0000242467

**Symptom:** The switch fails to disable password recovery through front panel button functions.

**Scenario:** When the Clear Password function is disabled for the front panel buttons using the CLI command `no front-panel-security password-clear`, the switch fails to disable Password recovery function for front panel buttons with the CLI command `no front-panel-security password-recovery`.

**Workaround:** Enable Clear Password function before disabling Password Recovery function for front panel buttons.

## Job Scheduler CR\_0000244075

**Symptom:** The switch fails to execute scheduled jobs.

**Scenario:** When Daylight Savings rule (DST) is configured on the switch close to the DST begin time and the switch time shifts by one hour, the switch fails to execute already configured jobs.

**Workaround:** Remove previously configured jobs and re-configure them after the DST rule is configured and the switch clock shifts by one hour.

## LLDP CR\_0000241838

**Symptom:** The switch displays incorrect "Device ID" in the CDP output.

**Scenario:** When the Chassis ID TLV contains an IPv4 address, the "Device ID" is not correctly displayed in the output of CLI commands `show cdp neighbor detail` and `walk ciscoCdpMib`.

**Workaround:** Use LLDP Chassis ID TLV to retrieve the "Device ID" information of the peer device.

```
show lldp info remote-device <PORT-LIST>
```

## Logging CR\_0000244348

**Symptom:** The switch is sending incorrect notification regarding configuration changes to the syslog server.

**Scenario:** If the switch is configured to send notifications about changes in running configuration (`logging notify running-config-change`), when it receives client LLDP-MED information with priority, the switch incorrectly sends a notification regarding switch configuration changes to the syslog sever.

## Multicast CR\_0000243253

**Symptom:** The switch fails to deliver multicast traffic destined to clients managed by an AP.

**Scenario:** When using device profile for clients managed by an AP, the switch fails to direct multicast IGMP if enabled on the VLAN after the device-profile is applied.

**Workaround:** Perform one of the following:

1. Enable IGMP on the VLAN before connecting the AP device with the device-profile that dynamically adds ports in the respective VLAN.
2. If IGMP is enabled on the VLAN after device-profile is activated, disable and enable device-profile on the switch.

## OSPF

### CR\_0000240127

**Symptom:** The switch generates a misleading OSPF authentication RMON event log.

**Scenario:** When the switch is configured with OSPFv2 authentication mechanism, the switch may generate incorrect RMON events similar to `OSPF: RECV: Discarding packet on interface vl3011: Invalid authentication key.`

### CR\_0000243557

**Symptom/Scenario:** The word "compatibility" is misspelled "compatability" in the output of the `show ip ospf general` command.

## REST

### CR\_0000241895

**Symptom:** The REST incorrectly returns 204 response.

**Scenario:** When REST makes a DELETE request with double slash ("/") characters in the request URI and a valid session ID as cookie, the switch incorrectly returns 204 response.

```
DELETE http://<hostname>/rest/v1//login-sessions
```

**Workaround:** Remove the extra slash ("/") characters from the URI.

## sFlow

### CR\_0000243278

**Symptom:** In certain sFlow polling and sampling ratios, the switch fails with a software exception error.

**Scenario:** When the sFlow is configured for a large number of ports with a low sampling rate for the actual level of network utilization, the switch may fail with a software exception error.

**Workaround:** Increase the sFlow sampling rate based on the network traffic burst.

## SSH

### CR\_0000241598

**Symptom:** SSH connections to the switch management fail to be established.

**Scenario:** If an SSH connection has been removed by an asynchronous network error, when established using switch data ports, the subsequent sessions to the switch gets immediately closed, unable to fully open a session.

**Workaround:** Use the switch OOBM IP address to establish SSH connections or use telnet.

## Transceivers

### CR\_0000237544

**Symptom:** Switch fails with an error message similar to `Software exception at ppmgr_portInterrupt.c: <...> -- in 'mPmSlvCtrl' <...>.`

**Scenario:** During the switch boot up with mix of 10M, 100M and 1000M copper port link partners with SFP transceiver 1000SX on dual personality ports, the switch may fail with an error message similar to `Software exception at ppmgr_portInterrupt.c: <...> -- in 'mPmSlvCtrl' <...>`.

**Workaround:** Insert the SFP 1000SX transceivers in dual personality ports after the switch is fully booted up or disable the ports with these transceivers before the switch reboot and re-enable after the switch is completely rebooted.

## CR\_0000243304

**Symptom:** The switch fails with an error message similar to `Software exception at ppmgr_portInterrupt.c` during boot up.

**Scenario:** When there is a mix of 10M, 100M, and 1000M copper ports with active linked partners and there are 1000SX SFP transceivers present in dual-personality ports, the switch may fail during boot up.

**Workaround:** Disable dual-personality ports with SFP transceivers present before rebooting the switch, then re-enable the dual-personality ports after the switch is completely rebooted. Or remove the SFP transceivers and re-insert after the reboot.

## User Roles

### CR\_0000240708

**Symptom:** The switch incorrectly starts and closes a RADIUS Accounting session.

**Scenario:** When there is no user role returned in HP-User-Role VSA from the RADIUS server for the authenticated user or the user role does not exist and the user is placed in the initial user role, the switch incorrectly starts and closes a RADIUS Accounting session..

**Workaround:** There is no functional impact as the switch is sending unnecessary back-to-back start and stop accounting requests.

## Version 16.02.0024

Version 16.02.0024 was never released.

## Version 16.02.0023m

Version 16.02.0023m was never released.

## Version 16.02.0022m

## Authentication

### CR\_0000235976

**Symptom:** Clients in guest VLAN (`unauth-vid`) are not reauthenticated.

**Scenario:** When RADIUS server is not available for authentication, if the client is placed in guest VLAN (`unauth-vid`) and the port is not configured for reauthentication, the switch does not re-authenticate the client after the RADIUS server connectivity becomes available.

**Workaround:** Do one of the following to resolve the issue:

1. Disable and re-enable the authentication port.
2. Configure re-authentication on the port ("`reauth-period`").

### CR\_0000236646

**Symptom:** An authenticated port configured with controlled traffic direction may fail to egress packets to the port.

**Scenario:** When an authenticated port is configured as a spanning-tree edge port using CLI command `spanning-tree <PORT> admin-edge-port`, the port's operational controlled direction does not change correctly from "BOTH" to "IN" state.

**Workaround:** Disable and re-enable the interface using CLI command `interface <PORT> disable | enable`.

## Central CR\_0000236990

**Symptom:** Incorrect switch IP address is displayed in the Central UI.

**Scenario:** When the switch is configured with multiple IP addresses on the uplink interface, the DeviceInfo and SystemInfo stats in the Central UI may report incorrect switch IP address info.

## DHCP Snooping CR\_0000239864

**Symptom:** Some DHCP clients do not receive a DHCP IP address.

**Scenario:** When the switch is enable for DHCP snooping, it may generate a malformed DHCP OFFER packet when processing the DHCP options of a DHCP packet received from the DHCP server.

**Workaround:** Configure the port where these DHCP packets are received as trusted using the `dhcp-snooping trust` command.

## Multicast CR\_0000237850

**Symptom/Scenario:** The switch is incorrectly flooding MLD reports received with a Well Known Multicast IPv6 address.

## MVRP CR\_0000238146

**Symptom:** The switch fails to display the correct warning message.

**Scenario:** When the switch is configured with MVRP and IGMP/MLD, MVRP's dynamic port membership may affect IGMP/MLD's forwarding behavior. Similarly, MVRP dynamic port membership assignment may also affect IGMP forwarding behavior.

When MVRP is enabled on the switch, if IGMP/MLD is already enabled on any VLAN, the following warning messages are displayed and RMON logs are generated:

```
MVRP's dynamic port membership may affect IGMP's forwarding behavior.  
MVRP's dynamic port membership may affect MLD's forwarding behavior.
```

When IGMP is enabled on any VLAN, if MVRP is already enabled on the switch, the following warning message is displayed and RMON log is generated.

```
IGMP's forwarding behavior may be affected by MVRP's dynamic port membership.
```

## PBR CR\_0000236962

**Symptom:** Switch may fail to forward policy based routed traffic.

**Scenario:** When a redundancy switchover takes place with policy based routing nexthop configured, the switch may fail to correctly forward the traffic until ARP cache is updated.

**Workaround:** Remove all non-permanent entries in the ARP cache using CLI command `clear arp`.

## Rogue AP Isolation CR\_0000238207

**Symptom:** The switch incorrectly logs Rogue AP detection event messages.

**Scenario:** The switch incorrectly logs the isolation of rogue APs, although the Rogue IP Isolation is disabled.

Example:

```
switch# show rogue-ap-isolation
```

```
Rogue AP Isolation
Rogue AP Status : Disabled
Rogue AP Action : Block
```

**Workaround:** Add the known APs which have been reported as rogue-APs to the switch white-list using the `rogue-ap-isolation whitelist` command.

## SNMP CR\_0000236648

**Symptom:** Switch may fail with an error message similar to `Health Monitor: Restr Mem Access <...> Task='mSnmpEvt' <...>`.

**Scenario:** When the security log is almost full, if a new security event is triggered while the SNMP traps such as `fault-finder`, `connection-rate` are generated, the switch may fail.

## CR\_0000237141

**Symptom:** SNMPv3 target address configured parameters are not displayed in the switch running configuration.

**Scenario:** When SNMPv3 is configured with target parameters using the CLI command `snmpv3 targetaddress <ASCII-STR> params <ASCII-STR>`, the parameters are not displayed in the output of CLI command `show running-config`.

**Workaround:** Use the CLI command `show snmpv3 targetaddress` to display target configured parameters.

## SSH CR\_0000236513

**Symptom:** Switch may crash with an error message similar to `Health Monitor: Invalid Instr Misaligned Mem Access <...> Task='tWatchD'`.

**Scenario:** When the SSH public-keys are installed without comments using the switch OS version `xx.15.17.xxxx` or older and the switch is upgraded to a newer OS version, the switch may crash when issuing the CLI command `show crypto client-public-key`.

**Workaround:** Install all SSH public keys with comments section or remove all SSH public keys installed without comments before upgrading the switch to a newer OS version.

## VLAN CR\_0000240169

**Symptom/Scenario:** When issuing the CLI command `no interface <port> forbid vlan <vlan_id>`, if the respective port is not on the VLAN forbidden port map, the switch becomes unresponsive.

## Version 16.02.0021

### Authentication CR\_0000232197

**Symptom:** The switch may delay the request for authentication credentials.

**Scenario:** When accessing telnet and console session, the switch prompts for authentication credentials with a slight delay.

**Workaround:** Use SSH to access the switch to get the prompt for authentication credentials immediately.

## PoE

### CR\_0000230920

**Symptom:** Different values are displayed for the PSE's allocated power when comparing the output of `show lldp` and `show power <port>`.

**Scenario:** The issue will trigger if the port is configured to `poe-allocate-by class` after the attached PD sends an LLDP power request.

**Workaround:** Disable and re-enable the port or reattach the PD after changing the `poe-allocate-by` value.

## Smart Link

### CR\_0000235633

**Symptom:** Standby Smart Link ports do not become active even if the active port goes down when one member is powered off.

**Scenario:** In a switch stack with non-consecutive Smart Link ports, if one member is powered off, the other non-consecutive ports also go down.

**Workaround:** Configure Smart Link ports as consecutive ports.

## SSH

### CR\_0000233725

**Symptom:** A delay is observed with ping response between the switch and the RADIUS server. Slow CLI response from SSH sessions are also observed.

**Scenario:** Symptoms occur when RADIUS Accounting is configured for Network and the interim-update is configured with MAC-based or 802.1X clients for a duration of 1 minute.

**Workaround:** Do one of the following:

1. Remove the RADIUS Network Accounting interim-update configuration.
2. Increase the interim-update interval to more than 5 minutes.

## Stacking

### CR\_0000222585

**Symptom:** When applying a source-port filter to the uplink ports of every stack member, the source-port configuration is not applied to one or more stack members.

**Scenario:** The issue occurs in a backplane or VSF stack if the members initially have source-port filters configured, then are removed from the stack and subsequently re-added prior to re-applying the source-port filter.

**Workaround:** Remove source-port filter configurations manually by using the command `no filter source-port` before removing the stack member.

### CR\_0000230530

**Symptom:** The switch stack may show incorrect global uptime.

**Scenario:** If the stack members have different timestamps prior to stack formation, when the stack is formed and a redundancy switchover event occurs, the global uptime may not be reported accurately.

**Workaround:** Synchronize the timestamp across switches prior to configuring them in a stack.

## Version 16.02.0020

### Console

#### CR\_0000230819

**Symptom:** The switch console may become unresponsive.

**Scenario:** When disconnecting the console session, connected to a standby or member switch of a stack, using **ESC + ~**, the console may not disconnect properly and become unresponsive causing the respective stack member to crash with an error message similar to `Software exception at multMgmtUtil.c:141 -- in 'mLoopPTx' <...>`.

### LLDP

#### CR\_0000232922

**Symptom:** The switch reports an incorrect error message when it fails to configure the loopback interface IP address for LLDP advertisements.

**Scenario:** When attempting to configure the loopback interface IP address for LLDP advertisements, the switch displays an incorrect error message:

```
This IP address is not configured or is a DHCP address
```

Instead, the following error message should be displayed:

```
This IP address is not configured or is a DHCP/Loopback address
```

**Workaround:** Configure a statically assigned VLAN IP address for LLDP advertisements.

### OpenFlow

#### CR\_0000229081

**Symptom:** OpenFlow flow statistics counters may reset to zero and fail to increment after that.

**Scenario:** Packet count in the flow statistics reported in the CLI command `show openflow instance <name> flows` may stop incrementing. OpenFlow flows may fail to age out and the hard/idle timeout for the affected flows may not expire.

**Workaround:** Disable and re-enable OpenFlow instance state.

#### CR\_0000229141

Added support for 'stats' flag in OpenFlow meter. The switch advertises `OFPMF_STATS` as a configurable flag when creating/modifying a meter. You are now able to get the meter statistics using the multipart message for any configured meter.

With the added support of `STATS`, the users will be able to query the statistics only if the `STATS` flag is configured along with the `KBPS/PKTPS` flags. Users will no longer be able to query the statistics without `STATS`.

#### CR\_0000229248

**Symptom:** OpenFlow traffic may not be sent to the correct priority queue.

**Scenario:** OpenFlow traffic with DSCP priority remarked by the configured traffic meter is sent to the default priority queue, instead of the remarked priority queue.

### OSPF

#### CR\_0000233729

**Symptom:** The output of OSPF related commands, such as `show ip ospf [ external-link-state | link-state | statistics ]`, take an extended amount of time to run or display incomplete data.



**Scenario:** Any show command which includes `show ip ospf [ external-link-state | link-state | statistics ]`, takes an extended amount of time to run. Commands such as `show tech` contain multiple iterations which further exacerbate the amount of time needed to run the commands or data collected regarding OSPF status may be incomplete.

## PoE

### CR\_0000229939

**Symptom:** Switch port PoE status cannot be changed from the Web UI.

**Scenario:** In a stacked switch environment, the Web UI does not allow you to change the PoE status of a port belonging to a stack member other than commander switch. It reports an error message: `Not a valid PoE port.`

**Workaround:** Use the following CLI command to change PoE status for the port:

```
[no] interface <PORT-LIST> power-over-ethernet
```

## Private VLAN

### CR\_0000233782

**Symptom:** The switch may not properly forward traffic to the promiscuous port in the private VLAN.

When there is a client connected on a security enabled port and the port is an access port of the secondary VLAN, the client is not able to reach the router connected on the promiscuous port.

**Scenario:** In a private VLAN configuration, when using security enabled VLAN (for example, radius assigned attributes) on the secondary VLAN, the switch may fail to forward traffic from authenticated client to the promiscuous port.

**Workaround:** Disable security on the access port.

### CR\_0000234099

**Symptom:** The switch may not properly move a client's MAC address from one port to another.

**Scenario:** In a private VLAN, when a client moves from one access port to another on the same secondary VLAN across the ISL, the switch may not correctly move the client's MAC address to the new access port.

The MAC will clear when MAC age time expires, allowing the MAC address to be re-learned on the new port.

**Workaround:** Manually clear the MAC address from CLI to allow immediate MAC address re-learning on the new port.

## RMON

### CR\_0000230643

**Symptom:** The switch may generate false RMON alarm traps.

**Scenario:** After an uptime of over 500 days, the switch may generate false RMON alarm traps for the monitored MIB objects.

## sFlow

### CR\_0000228486

**Symptom:** sFlow displays invalid levels of dropped samples.

**Scenario:** When using trunk interfaces, sFlow is incorrectly calculating the levels of dropped samples displayed in the output of the CLI command `show sflow <INSTANCE> sampling-polling`.

## Smart Link CR\_0000229453

**Symptom:** The switch may fail to forward traffic on ports with Smart Link enabled.

**Scenario:** When changing the Spanning Tree mode or the port status of the Spanning Tree enabled ports, the Smart Link enabled ports may stop forwarding the traffic.

**Workaround:** Disable and re-enable the affected Smart Link enabled ports.

## CR\_0000233339

**Symptom:** The Smart Link port might flood VLAN traffic even though it is not a member of that VLAN.

**Scenario:** When the switch is configured with Smart Links and multiple VLANs, VLAN traffic is sent on Smart Link ports that are not a member of those VLANs.

**Workaround:** No workaround. Remove the Smart Link port configuration to avoid this issue.

## SSH CR\_0000229176

**Symptom:** Unable to access switch via SSH.

**Scenario:** When using raw console terminal (`console terminal none`) with message of the day banner configured (`banner motd`) and SSH session to the switch may fail with the error message `Session terminated, unable to login`.

**Workaround:** Configure console ANSI or VT100 console terminal or disable message of the day banner.

## CR\_0000232500

**Symptom:** Switch fails to authenticate an SSH client using keyboard-interactive method.

**Scenario:** When the switch access is enabled for SSH public key authentication (for example, `aaa authentication ssh login public-key`), if the SSH client fails to authenticate using client private key for N-1 configured number of authentication attempts (for example, `aaa authentication num-attempts N`), the switch does not failover to authenticate the client using keyboard-interactive method. The switch causes the client authentication to fail with an error message similar to `Too many authentication failures, even when one more attempt is available`.

## UDLD CR\_0000229788

**Symptom:** In a redundant configuration, the switch may stop forwarding traffic on LACP aggregated ports.

**Scenario:** In a redundant configuration with Spanning Tree enabled, when multiple redundancy switchover events occur, the switch may fail to forward traffic over an LACP trunk which has UDLD enabled in "verify-then-forward" mode.

**Workaround:** Disable and re-enable Spanning Tree. Alternatively, disable and re-enable the affected port.

## Version 16.02.0019

Version 16.02.0019 was never released.

## Version 16.02.0018

### CDP

#### CR\_0000228335

**Symptom:** Switch reports an error message `Module command missing for port or invalid port <TRUNK-NAME>` when a configuration file is restored from backup.

**Scenario:** When a backup configuration file contains a CDP setting (for example, `no cdp enable <TRUNK-NAME>`) for a trunk port, the switch fails to restore it and reports an error message similar to:

```
line: 6. Module command missing for port or invalid port <TRUNK-NAME>.
Corrupted download file.
```

### CLI

#### CR\_0000210794

**Symptom:** Stack member uptime information is incorrect in the output of the CLI command `show redundancy detail`.

**Scenario:** The timestamp is incorrectly calculated for "Module Up Since" and "State Since" values displayed in the output of the CLI command `show redundancy detail`.

### Device Profile

#### CR\_0000213606

**Symptom:** Device profile removed and re-applied after a redundancy switchover event.

**Scenario:** After failing over to standby in an HA (high availability) configuration, the Device Profile is removed and reapplied to the port. This may result in service interruption on that port.

### DHCP Snooping

#### CR\_0000228042

**Symptom:** An incorrect RMON message is logged when a DHCP RELEASE message is dropped by DHCP Snooping on the switch.

**Scenario:** If DHCPv4-Snooping and IPv4 routing are enabled when the switch receives a unicast DHCP client message (RELEASE/DECLINE), the switch logs an incorrect RMON message `Attempt to release address <IPv4 address> leased to port <lport_src> detected on port <lport_src>`. However, this switch does not have the lease entry updated in the DHCPv4-Snooping binding state table (BST).

In environments with multiple DHCP servers reachable through different network paths, the message is logged repeatedly.

### Direct Attach Cables

#### CR\_0000218616

**Symptom:** Partner devices may prematurely detect link UP state when connected with DAC cable.

**Scenario:** During the switch reboot with DAC cable connected to a partner device, the port may be set in ready state too soon causing the link partner device to initiate traffic before the switch is ready.

**Workaround:** Disable and re-enable the switch interface to re-negotiate the L2 state.

### Fault Finder

#### CR\_0000223670

**Symptom:** The switch incorrectly allows ports with fault-finder enabled for broadcast-storm to be configured for link aggregation.

**Scenario:** The switch should prevent a port configured for fault-finder alarms to also be configured for link aggregation (trunk). Similarly, in case a port is already in a link aggregation (trunk), the switch should not allowed to configure it with fault-finder alarms for broadcast storm. For such instances, the switch should deny the requested configuration and prompt an error message similar to:

```
Fault-finder broadcast-storm configuration cannot be applied to members of a trunk
port(s) <PORT-NUM>.
```

```
Port <PORT-NUM> with fault-finder broadcast-storm configuration cannot be added to
a trunk.
```

## IGMP CR\_0000227470

**Symptom:** In certain scenarios, the multicast traffic may not flow towards clients and traffic may not be forwarded to IGMP Querier or PIM routers from a non-Querier.

**Scenario:** In the event that a port, identified as a router-detect port for more than one IGMP-enabled VLAN, stops being the router-detected port for one of the VLANs, the switch may stop forwarding IGMP Membership Reports from Non Querier to Querier device for all IGMP-enabled VLANs for which the port is identified as router-detected port. A port may stop being a router-detected port for a VLAN whenever the querier for that VLAN changes and it is no longer detected via respective port, or due to administratively disabling IGMP or PIM on that VLAN, or in case of a DT topology, distributed trunk port membership configuration changes are made.

**Workaround:** Enable IGMP isolation for un-joined multicast groups using CLI command `igmp filter-unknown-mcast` on global context. This filter limits multicast traffic flooding only on interfaces that contain queriers that are on the same VLAN as the multicast traffic. Enabling of the `igmp filter-unknown-mcast` will consume one filter per IGMP enabled VLAN, impacting the IGMP Group Capacity (i.e. the number of IGMP groups that can be forwarded without flooding). For more information on using the `igmp filter-unknown-mcast` command, see the *ArubaOS-Switch Multicast and Routing Guide* for your switch.

## MAC Authentication CR\_0000228130

**Symptom:** Switch may not correctly forward traffic on a successfully authenticated port with mac-authentication.

**Scenario:** When a switch port is configured for concurrent mac-authentication and 802.1X in client-mode, if this setting is overridden and changed to port-mode through RADIUS VSA 'HP-Port-Auth-Mode-MA' after a successful client authentication on the port with this RADIUS attribute, the switch may not correctly forward traffic when configured for ingress traffic control.

Example: `aaa port-access <PORT-LIST> controlled-direction in`

**Workaround:** Disable 802.1X on the port and reconnect or re-authenticate the client with RADIUS VSA 'HP-Port-Auth-Mode-MA' attribute.

## Mirroring CR\_0000227861

**Symptom:** The switch displays incorrect mirroring policy status.

**Scenario:** The switch displays incorrect 'inactive' status in the output of CLI command `show monitor` when a mirror policy is applied to a VLAN.

**Workaround:** Execute CLI command `show monitor <mirror-session>` to check the mirror policy status.

## OOBM CR\_0000170024

**Symptom:** Communication through the OOBM port may fail.

**Scenario:** When the OOBM Port is disabled in the switch configuration (`oobm interface disable`), after a redundancy switchover event occurs, the OOBM Ports status remains "down" when the OOBM interface is re-enabled from the CLI command `oobm interface enable`.

**Workaround:** Disable and enable the OOBM interface once more to bring it up.

```
oobm interface disable
oobm interface enable
```

## OSPF CR\_0000225246

**Symptom:** Intermittent connectivity loss to certain IPv6 destinations after an extended period of switch uptime.

**Scenario:** It is possible after an extended period of uptime for the switch to incorrectly calculate the OSPFv3 Link State Advertisement (LSA) Refresh Age time and fail to refresh its self-originated LSAs. As a result, peer switches may incorrectly delete the routes to the prefixes in these LSAs from their Routing Information Base (RIB) for 30 minutes.

**Workaround:** On the originator switches, enabling `debug ipv6 ospfv3` and then disabling (`no debug ipv6 ospfv3`) will trigger an immediate refresh for LSAs which are over the age of 1800 seconds.

## PoE CR\_0000226003

**Symptom:** An invalid config entry is added to the switch for a port where some PDs are connected: `power-over-ethernet 0`.

**Scenario:** When connected PDs request port priority via LLDP MED, such as Cisco 7910G or similar PDs, and `poe-lldp-detect` is enabled on the respective switch port, an invalid config entry is added to the switch for the respective port `power-over-ethernet 0`. For switches which support stacking, this may cause the switch to crash with a message similar to:

```
Health Monitor: Read Error Restr Mem Access <...> Task='mPoeMgrCtl' <...>
```

**Workaround:** Disable `poe-lldp-detect` on the port where the respective PD is connected to clean up the invalid configuration entry.

## QoS CR\_0000227806

**Symptom:** The switch may crash with an error message similar to `Software exception in ISR at btmDmaApi.c <...> No resources available!`

**Scenario:** When QoS for IP protocol is enabled and IPv6 traffic such as DHCP requests or IPv6 multicast is running on the network, the switch may crash with an error message similar to `Software exception in ISR at btmDmaApi.c <...> No resources available!`

**Workaround:** Disable QoS for IP protocol.

## Routing CR\_0000223965

**Symptom:** Default route is not listed in the output of CLI command `show ip route`.

**Scenario:** When a VLAN interface is configured as the next-hop for the default static route, the route entry is not displayed in the output of the CLI command `show ip route`, while the static route counter is incremented in the output of the CLI command `show ip route summary`.

## CR\_0000228710

**Symptom:** In certain scenarios, the switch may have connectivity issues to certain destinations or induce routing loops in the network.

**Scenario:** The switch may incorrectly process certain routes in the routing table and erroneously choose less specific routes over more specific ones. These routes will remain in the routing table until they are flushed. This behavior may cause routing loops to occur, inability to reach the default gateway, or other similar routing symptoms that could vary by routing protocol. This condition may be exacerbated by the number of routes being learned within a short time.

## Spanning Tree CR\_0000227215

**Symptom:** Incorrect VLAN ID is displayed in the output of CLI command `display stp region-configuration`.

**Scenario:** A 4-digit VLAN ID number is truncated to 3 digits in the output of CLI command `display stp region-configuration`.

**Example:** Correct VLAN ID using `show spanning-tree mst-config`:

```
Instance ID Mapped VLANs
-----
1           2, 6-8, 10-14, 20-22, 1022, 1029, 1035
```

**Example:** Truncated VLAN ID using `display stp region-configuration`:

```
Instance      Vlans Mapped
1             2, 6 to 8, 10 to 14, 20 to 22, 102, 102, 103
```

**Workaround:** Use CLI command `show spanning-tree mst-config` to get the correct VLAN IDs mapped to the Spanning Tree instance.

## Switch Module CR\_0000228591

**Symptom:** The switch may crash with an error message similar to `Software exception in kernel context at ghsException.c Internal system error`.

**Scenario:** When running traffic through the 10G ports of the expansion switch module, the switch may crash with an error message similar to `Software exception in kernel context at ghsException.c Internal system error`.

## Syslog CR\_0000210928

**Symptom:** Syslog messages do not contain the configured source IP address.

**Scenario:** When a source IP address or interface is configured for syslog protocol (`ip source-interface syslog {<IP-ADDR> | vlan <VLAN-ID> | loopback <LOOPBACK-ID>}`), the syslog message always contains the IP address of the VLAN the syslog is sourced from, instead of the configured source IP address, VLAN or loopback interface.

## Web UI CR\_0000227777

**Symptom:** Port mode setting may be incorrectly shown in the VLAN Properties section of the VLAN Management web page.

**Scenario:** When a port is selected in the VLAN Properties section of the VLAN Management web page, the "Mode for selected ports" may be different from what is displayed in the output of CLI command `show vlan <VLAN-ID>`.

**Workaround:** Use CLI command `show vlan <VLAN-ID>` to obtain the configured port mode.

## Version 16.02.0017

Version 16.02.0017 was never released.

## Version 16.02.0016

### Authentication CR\_0000226106

**Symptom:** The switch does not transmit LLDP packets.

**Scenario:** The switch no longer transmits LLDP packets on the port after it is configured for AAA port-access authentication.

### Banner CR\_0000225460

**Symptom:** SNMPv3 get request on the switch login banner SNMP OID fails with `tooBig` error message.

**Scenario:** When switch post-login banner or MOTD banner is configured with more than 1300 characters, running an SNMPv3 get request on the corresponding banner SNMP OID will fail with the error message `Reason:[tooBig]`.

**Workaround:** Use SNMPv2 get request on SNMP banner OID when the configured login banner size is larger than 1300 characters.

### Cable Diagnostic CR\_0000222089

**Symptom:** Non-support for cable diagnostic tests is not indicated prior to executing the tests.

**Scenario:** When executing the CLI command `test cable-diagnostics <PORT-LIST>`, on a switch port that does not support this feature, the following execution warning message is displayed for non-supported ports:

```
This command will cause a loss of link on all tested ports and will take several seconds per port to complete. Use the 'show cable-diagnostics' command to view the results. Continue (y/n)? Y.
```

The non-support for such test is indicated only when displaying the test results using CLI command `'show cable-diagnostics' command`, in a report message such as `Port <port-number> does not support cable diagnostics`.

### DHCP CR\_0000222120

**Symptom:** The switch DHCP server may delay honoring IP address renewal requests.

**Scenario:** When a client which acquired an IP address from the switch DHCP server is roaming to a different VLAN also managed by the switch DHCP server, a fresh new DHCP client request process is initiated in place of the DHCP renewal request process, resulting in a longer delay for the DHCP client to acquire the new IP address.

**Workaround:** Using an external DHCP server may help resolve the delay in DHCP client IP renewal when roaming from one VLAN to another.

## DHCP Server CR\_0000216603

**Symptom:** DHCP clients are not able to obtain IP addresses from the switch's locally configured DHCP server address pool.

**Scenario:** When the default route (0.0.0.0/0) is configured with a VLAN as the next hop, the DHCP request packets are being dropped and the DHCP clients are not able to obtain IP address from the switch DHCP server.

**Workaround:** Configure the default route's next hop value with an IP address instead of a VLAN.

## Event Log CR\_0000225392

**Symptom:** The proper event log message is not generated when a port is blocked due to a link failure detection protocol.

**Scenario:** When a port is configured for Device Link Detection Protocol (DLDP) or Uni-directional Link Detection (UDLD) and a link failure is detected, the switch fails to log corresponding event log messages similar to:

```
00435 ports: port <NUM> is Blocked by DLDP
```

```
00435 ports: port <NUM> is Blocked by UDLD
```

## Job Scheduler CR\_0000221236

**Symptom:** The switch does not execute scheduled jobs at expected scheduled time.

**Scenario:** When the switch time settings are adjusted for time protocol, time zone or daylight savings time rule (daylight-time-rule), the Job Scheduler fails to execute scheduled jobs at the configured time. This is triggered when switch time is (re-)adjusted, following a time settings change. For example, adding a daylight-time-rule would trigger a time re-adjustment, but the job scheduler time is not re-adjusted with the new switch time settings and it will not trigger job execution at the expected time.

**Workaround:** Remove and re-configure the jobs after making configuration changes to the switch time settings.

## CR\_0000222032

**Symptom:** The switch may crash with an error message similar to `Health Monitor: Read Error Restr Mem Access <...> Task='tCron000001' <...>` when executing a scheduled job.

**Scenario:** If a job is scheduled to copy data files to/from a remote server configured via hostname, the switch may crash with an error message similar to `Health Monitor: Read Error Restr Mem Access <...> Task='tCron000001' <...>` when executing the job at scheduled time.

**Example:** `job <name> at [HH:]MM "copy running-config tftp mytftpserver.com FILENAME-STR"`.

**Workaround:** Configure the job to copy data files using IP address instead of hostname.

**Example:** `job <name> at [HH:]MM "copy running-config tftp 192.168.0.1 FILENAME-STR"`.

## OpenFlow CR\_0000219687

**Symptom:** OpenFlow fails to authenticate a client with a DHCP-assigned IP address.

**Scenario:** OpenFlow fails to authenticate a client with a DHCP-assigned IP address, when the DHCP client and the DHCP server are connected on different OpenFlow VLANs with IP routing enabled.

**Workaround:** Configure DHCP server on a non-OpenFlow VLAN.



## SNMP CR\_0000217437

**Symptom:** Switch does not report the information regarding IPv6 loopback interface reported in MIB object `ipAddressIfIndex`.

**Scenario:** After an IPv6 link-local address is configured on a VLAN, the switch no longer reports the information regarding IPv6 loopback interface reported in MIB object `ipAddressIfIndex` when executing CLI command `walkMIB ipAddressIfIndex`.

## Spanning Tree CR\_0000201299

**Symptom:** A switch configured with RPVST may crash with an error message similar to `Software exception at btTfMsgSysDrv.c <...> -- in 'mPvstSlvCtrl' <...>`.

**Scenario:** When disabling Spanning Tree on a switch that is part of RPVST topology, an external loop may be created. As a result, a broadcast of RPVST BPDUs may be received by the switch, potentially leading to a crash with an error message similar to `Software exception at btTfMsgSysDrv.c <...> -- in 'mPvstSlvCtrl' <...> ASSERT: No resources available!`

**Workaround:** Make sure that no external loops are created when disabling Spanning Tree on any switch that is part of an RPVST topology.

## CR\_0000217382

**Symptom:** Switch ports enabled for BPDU protection are not properly flagged as administratively down in `show interface brief` output when BPDU traffic is detected.

**Scenario:** When BPDU traffic is detected on a BPDU protected port, the port is being operationally brought down (logically disabled) due to BPDU detection, although it is still being maintained enabled for administrative purposes in the output of CLI command `show interface brief`. Administrative status of the port is mainly intended to be changed by manually enabling/disabling the port from CLI command `interface <PORT-LIST> enable | disable`.

Port	Type	Alert	Enabled	Status	Mode	Mode	Ctrl
1	10/100TX	No	Yes	Down	100FDx		MDI off

The BPDU protected port is operationally disabled when BPDU traffic is detected and only its administrative state is enabled.

```
ifAdminStatus.1 = 1      (up)
ifOperStatus.1 = 2      (down)
```

## Stacking CR\_0000197626

**Symptom:** A stack might fail to split according to the configured split policy.

**Scenario:** In a 2-member stack configuration, when the OOBM interface is configured for dynamic DHCP IP address, a stack might fail to split according to the configured split policy.

**Workaround:** Configure any of the OOBM interfaces with static assigned IP address.

## CR\_0000211777

**Symptom:** The standby member ID is not properly updated.

**Scenario:** When the standby member of a stack is rebooted or lost, the standby member ID is not properly updated with the new standby ID. This condition potentially impacts subsequent stacking events, failover, and stack member role mitigation.

**Workaround:** No known workaround. Rebooting the stack will clear stale standby member ID information.

## Terminal CR\_0000223941

**Symptom:** The terminal command line is not working properly after terminating a session to the switch.

**Scenario:** After a VT100 terminal session to the switch is terminated, the terminal line wrap-around configuration is disabled.

**Workaround:** Re-enable "line-wrap" mode via SNMP command `setmib hpicfPrivateTermLineWrap.0 -i 6` followed by configuration save and reboot.

## Trunking CR\_0000211583

**Symptom:** In a certain scenario, the switch allows to create a trunk interface with more than a maximum of 8 ports.

**Scenario:** When a fast copy and paste operation with multiple port addition entries to the same trunk interface is used to create a trunk interface, more than the maximum 8 allowed ports can be added to the trunk. Once such invalid trunk interface is created, no other changes to the trunk interface are allowed from CLI.

Example: Copy & Paste from text file:

```
trunk 1-4 trk1
```

```
trunk 5-9 trk1
```

**Workaround:** To avoid triggering, do not use a fast copy and paste function to configure the trunk group. Once triggered, use the Menu interface to remove additional ports exceeding the maximum of 8 from the invalid trunk interface.

## Tunneling CR\_0000197220

**Symptom:** Unexpected broadcast traffic is received on ports not enabled for tunnel-node.

**Scenario:** In a switch where ports configured for tunnel-mode support and ports not configured for tunnel-node belong to the same VLAN, the broadcast traffic destined only to ports enabled for tunnel-node is observed on ports without tunnel-node enabled.

**Workaround:** Configure source port filter to filter traffic from tunnel-node ports to non-tunnel-node ports.

Example: `filter source-port <non-TN-port> drop <TN portlist>`

## Version 16.02.0015

No fixes were included in version 16.02.0015.

## Version 16.02.0014

## Authorization CR\_0000216097

**Symptom:** In certain conditions, the User Roles feature may be unintentionally disabled.

**Scenario:** If the User Role feature is already enabled on the switch and an unsuccessful switch configuration restore using a file transfer occurs, the User Role may become disabled.

**Workaround:** Manually disable and then re-enable the User Role feature using the CLI command `aaa authorization user [disable | enable]`.

## CR\_0000221546

**Symptom:** When executing unauthorized commands, the switch may fail to include a blank line before printing the error message `Not authorized to run this command`.

**Scenario:** When the switch is configured for TACACS+ command authorization and an unauthorized command is executed, the switch may fail to include a blank line before printing the error message `Not authorized to run this command`. This may cause some applications, such as IMC, to misunderstand the message.

## Console

### CR\_0000206708

**Symptom:** Management access to the switch through SSH, telnet or console may fail with an error message similar to `Connection closed by remote host`.

**Scenario:** New sessions may fail to be established after previous sessions are closed due to inactivity timeout when using certain client applications, such as MobaXterm, for management access to the switch through SSH, telnet or console.

**Workaround:** Rebooting the switch will clear the locked sessions. Alternatively, you can disable the inactivity timer using the CLI command `console inactivity-timer 0`. Once the inactivity timer is disabled, you must log out of each session to properly close the connection.

## IPsec

### CR\_0000221636

**Symptom:** IPsec tunnel may break in case of Layer-2 topology change.

**Scenario:** When the connection to the Controller is switched from one port to another (for example when a layer-2 topology change occurs), the IPsec tunnel will not be re-established due to the port UP notification being received on a different port.

**Workaround:** Re-start the IPsec session manually using CLI command `aruba-vpn type <vpn-type>`.

## MAC Authentication

### CR\_0000210511

**Symptom:** Switch ports may get into an endless MAC authentication cycle preventing re-authentication.

**Scenario:** When a switch port is configured for both 802.1X and mac-authentication, during the re-authentication process due to reauth-period expiry, the port may not be able to complete the re-authentication process and get into a MAC authentication loop.

**Workaround:** Disabling and re-enabling the affected port via CLI command `interface <port-num> enable | disable` should clear the problem.

## mDNS

### CR\_0000216815

**Symptom:** Switch may run out of memory and crash when receiving many multicast DNS packets.

**Scenario:** When receiving multicast DNS packets with ACL filter applied to the VLAN, the switch may crash due to running out of heap memory.

## OOBM

### CR\_0000214640

**Symptom:** Communication through OOBM IP address may be lost after a failover.

**Scenario:** After a failover event in a VSF or backplane stacking configuration, a gratuitous ARP may fail to be sent. The global OOBM IP address becomes unreachable because the new commander's MAC address is not associated with the OOBM IP address in the neighbor devices' ARP table.

**Workaround:** Issue a ping from the switch to any destination through the OOBM interface to update the ARP entry in the neighbor devices.

### CR\_0000216669

**Symptom:** OOBM port remains active after being administratively disabled.

**Scenario:** When in a VSF or hardware backplane stack, the global OOBM interface may not be turned off after being administratively disabled using the CLI command `oobm disable`.

**Workaround:** In addition to disabling the global OOBM, disable the OOBM interfaces for all stack members with the CLI command `oobm member <member-id> interface disable`.

## OpenFlow

### CR\_0000202097

**Symptom:** The OpenFlow rule duration may show invalid values.

**Scenario:** The OpenFlow rule duration may show invalid values in the output of CLI command `show openflow instance <instance-name-str> flows`, after the system time is updated following a switch boot.

**Workaround:** Toggle OpenFlow state on the switch (Disable/Enable).

### CR\_0000219033

**Symptom:** OpenFlow match on destination mac-groups does not work.

**Scenario:** OpenFlow instances with destination mac-grouping enabled are not correctly matched to destination mac-groups.

## SNMP

### CR\_0000214384

**Symptom:** SNMP ifTable reports invalid OID values for OOBM loopback interface.

**Scenario:** When a switch is configured in a stack, SNMP ifTable reports OID value '0' for 'ifType' (.1.3.6.1.2.1.2.2.1.3), 'ifAdminStatus' (.1.3.6.1.2.1.2.2.1.7), and 'ifOperStatus' (.1.3.6.1.2.1.2.2.1.8) corresponding to the OOBM loopback interface.

## SSH

### CR\_0000201108

**Symptom:** Switch configured with DSA key refuses SSH connections.

**Scenario:** When the switch is configured with host DSA public key, SSH connection from client using the generated public-key in switch cannot be established.

**Workaround:** Configure switch with host RSA public-key for SSH connections.

### CR\_0000217201

**Symptom:** The SSH server cannot be bound to well-known port numbers ranging from 0 to 1023.

**Scenario:** When using the CLI command `ip ssh port <port-num>`, the switch does not allow the SSH server to be configured to listen to well-known or system ports ranging from 0 to 1023. The switch displays the

error message Cannot bind reserved TCP port `<port-num>`, except when using "default" and 22 as the `<port-num>`.

**Workaround:** Configure the SSH server to listen for SSH connections on ports "default", 22, or ports greater than 1023.

## Trunking CR\_0000212455

**Symptom:** When trying to re-create a trunk, the switch may prompt the error message `Ambiguous input: trk...`

**Scenario:** When configured in a stacking mode, the switch may not be able to re-create a trunk after the last port of last stacking member was already configured as a member to another trunk.

**Workaround:** Do not configure last port of last stacking member as trunk port.

## Web UI CR\_0000216915

**Symptom:** Switch web UI may become unresponsive or encounter a script error.

**Scenario:** When a stackable switch is configured for stacking mode but no other stack member has joined the stack, the switch web UI may become unresponsive or return a script error.

**Workaround:** Disable stacking when only one stack member is needed or wait for another member to join before using web UI.

## Version 16.02.0013

Version 16.02.0013 was never released.

## Version 16.02.0012

## IGMP CR\_0000216285

**Symptom:** Losing management access to the switch.

**Scenario:** When the switch receives IGMPv3 query packets with the source IP address 0.0.0.0 or IGMPv3 query packet without Router Alert option, it may deem the switch unable to resolve the MAC address for the default gateway.

**Workaround:** Rebooting the switch or failing over to standby (where applicable) can temporarily restore connectivity to the switch.

## Version 16.02.0011

## GVRP CR\_0000204332

**Symptom:** The detailed information about mac-addresses dynamically learned by the switch is not correctly displayed in the output of the CLI command `show mac-address <mac-address>`.

**Scenario:** When mac-addresses are learned from a VLAN that was dynamically configured using GVRP, the CLI command `show mac-address <mac-address>` does not display any detailed information.

**Workaround:** Use the CLI command `show mac-address`.

## IP Tunnels

### CR\_0000212791

**Symptom:** In certain conditions, tunnel interface activation may fail.

**Scenario:** When the switch IP address configuration is modified after a tunnel interface was already configured on the switch, the tunnel activation may fail.

**Workaround:** Delete then re-create the tunnel interface after modifying the switch IP address.

## MAC Authentication

### CR\_0000201029

**Symptom:** Switch may crash with a message similar to `Health Monitor: Misaligned Mem Access <...> Task='eDrvPoll' <...>`, when data cable is plugged into a port.

**Scenario:** Switch may crash with a message similar to `Health Monitor: Misaligned Mem Access <...> Task='eDrvPoll' <...>`, when data cable is plugged into a port configured with mac-authentication and spanning-tree is enabled on the switch.

**Workaround:** Administratively disable the port and re-enable after the data cable is plugged into the port, disable the port using CLI command `interface <port-num> disable | enable`.

## OpenFlow

### CR\_0000193376

**Symptom:** Switch may not be able to connect to the SDN controller.

**Scenario:** After a reboot of another switch upstream on the path to the SDN controller, the switch may be unable to connect to the SDN controller.

**Workaround:** Reboot the switch.

## Redundancy

### CR\_0000212756

**Symptom:** Interface configuration of stack member might be lost from the global configuration.

**Scenario:** When a stack member switch is replaced with a new MAC address in an existing stack, the interface configuration corresponding to the replaced member switch is lost in the event of redundancy. This causes the current standby switch to switchover to the commander role.

**Workaround:** Perform another redundancy using CLI command `redundancy switchover`.

## Transceivers

### CR\_0000210703

**Symptom:** The OID `entLastChangeTime` value is not correctly updated.

**Scenario:** When a transceiver is inserted, moved or hotswapped, the switch does not correctly update the value reported in `entLastChangeTime` OID.

## Version 16.02.0010

## Stacking

### CR\_0000214504

**Symptom/Scenario:** After a stack failover to standby, the switch may fail to forward traffic.

**Workaround:** Toggling the affected links using CLI command `interface <port-num> disable | enable` can clear the issue.

## Version 16.02.0009

### Aruba Management Software CR\_0000214536

**Symptom/Scenario:** The ArubaOS-Switch-based switch fails to connect to the Aruba Activate server, potentially impacting Aruba Central connectivity and ZTP (zero-touch provisioning) using Activate for the AirWave and IPsec (connection with Aruba Controller for AirWave management traffic) solution. The switch logs an event message similar to `Activate: Received failure "response from the Activate server with status code: None"`.

### Trunking CR\_0000214638

**Symptom:** LACP link failure recovery might result in traffic outage.

**Scenario:** A connection outage to the peer device might be observed during the recovery from a link failure on a port member of an LACP trunk, when the switch's LACP links are connected to a non-ArubaOS-Switch-based switch on which LACP links are configured in Active/Standby mode.

## Version 16.02.0008

### Banner CR\_0000190968

**Symptom:** Copying a configuration file with a banner text containing the quote (") character could cause a crash.

**Scenario:** Copying a configuration file with a banner message containing the quote (") character spanning across multiple lines, might cause a crash with an error message similar to `Health Monitor: Restr Mem Access <...>`.

**Workaround:** Use short banner text or replace quote (") characters in the banner text message.

### CLI CR\_0000157943

**Symptom:** When copy command-output `show tech all tftp <server addr> <file name>` command is executed, the switch might crash.

**Scenario:** The switch might crash when IPv6 route entries in the system grows to a huge value.

### CR\_0000193389

**Symptom/Scenario:** CLI command `show interfaces queues <port-list>` fails with error message: `Module not present for port or invalid port: queues.`

**Workaround:** Upgrade to the most recent switch software revision.

### Console CR\_0000179094

**Symptom:** Sending special keys to a console switch configured in stacking mode may cause the switch to crash.

**Scenario:** Sending the **ESC** or **~** key to the console of a standby or member switch connected in a stack configuration may cause the switch to crash with an error message similar to `Software exception at multMgmtUtil.c <...>`.

## Counters

### CR\_0000189924

**Symptom:** Incorrect values are displayed for transmit and receive counters of an interface.

**Scenario:** The Broadcast and Multicast transmit and receive counter values from the CLI output of the `show int <ports>` command are incorrect.

## CPPM

### CR\_0000192066

**Symptom:** When working with Captive Portal feature with URL hash key enabled, if the Captive-Portal-URL attribute in CPPM includes any uppercase letter in the URL and the client attempts to browse, the redirection to the Captive Portal Login page works but an error is displayed preventing the user from entering credentials in the web page.

**Scenario:** Enter any uppercase letter on the Captive-Portal-URL attribute in CPPM.

**Workaround:** In CPPM, when configuring the Captive Portal profile attribute to redirect traffic to ClearPass, enter the value for the Captive-Portal-URL attribute in lowercase only.

## DHCP

### CR\_0000191729

**Symptom:** A switch acting as a DHCP Relay agent drops any DHCPINFORM packets with a TTL value set to 1.

**Scenario:** DHCPINFORM packets received with a TTL value of 1 are dropped by the DHCP Relay agent, so the DHCP client cannot acquire an IP address from the DHCP server.

**Workaround:** Configure the DHCP client network interface to use TTL values greater than 1.

## Display Issue

### CR\_0000190925

**Symptom/Scenario:** A 100% CPU usage spike occurs every 10 minutes, caused by the HTTP task calling the Entropy function.

## File Transfer

### CR\_0000192894

**Symptom:** Setting the session idle-timeout to lower settings can cause a file transfer to hang indefinitely.

**Scenario:** When session idle-timeout is configured to lower values, a file transfer exceeding the configured idle-timeout may hang indefinitely when executed from a remote session to the switch.

**Workaround:** Configure session idle-timeout value to a higher value to allow file transfers to complete before the idle timer expires.

## GVRP

### CR\_0000184015

**Symptom:** When an Aruba AP is connected to a switch port that has a device profile applied, a GVRP VLAN advertised from the Aruba AP gets created on the switch but VLAN membership of the switch port does not get modified to include the advertised GVRP VLAN.

**Scenario:**



1. Connect an Aruba AP to the switch and enable device profile.
2. Configure AP to send GVRP PDUs with some VLANs.
3. Check VLAN status on the switch port connected to Aruba AP, GVRP VLANs advertised by AP would not be seen for the AP connected port.

**Workaround:** Add the GVRP VLAN advertised from AP as part of device profile. The switch port connected to that AP would then be added as a member of that GVRP VLAN.

## IGMP CR\_0000189793

**Symptom:** Deleting and reconfiguring an IGMP or PIM VLAN interface might not forward multicast traffic correctly.

**Scenario:** Enable IGMP or PIM on a VLAN. Delete VLAN from the configuration and re-configure the VLAN.

**Workaround:** Disable IGMP or PIM before deleting and reconfiguring VLAN interface.

## IPv6 ND CR\_0000191216

**Symptom:** Non-human readable characters might appear in the output of CLI command `show running-config`.

**Scenario:** In a VFS stacking configuration, when LED savepower is turned on for all modules using the CLI command `savepower led all`, non-human readable characters might appear in the output of the CLI command `show running-config`.

**Workaround:** Use CLI command `save power led <slot-list>` with SLOT-ID or range options.

## MAC-Based VLANs CR\_0000183936

**Symptom:** If a MAC is configured as a static-mac address on the switch, the same MAC might be detected as rogue and may not be blocked by the rogue-ap-isolation feature.

**Scenario:** After configuring a static mac with the command `static-mac <mac-address> vlan <y> interface <z>` and enabling the rogue-ap-isolation feature using the `rogue-ap-isolation enable` command, the MAC is not blocked by the rogue-ap-isolation feature due to conflict and the following RMON message is displayed:

```
Blocking rogue device <mac-address> failed as it conflicts with either lockout MAC or static MAC configuration.
```

**Workaround:** There are two workarounds for this issue:

1. Enable rogue-ap-isolation feature before configuring the static-mac address for that MAC to ensure that it is blocked.
2. Remove the static-mac configuration for the `<mac-address>` to ensure that it is blocked by rogue-ap-isolation.

## Menu CR\_0000198649

**Symptom:** An incorrect maximum number of supported authorized managers is specified in the help text message of the Menu interface.

**Scenario:** The message text of the IP Authorized Managers Help Screen Menu interface states A maximum of 10 addresses is supported. The switch allows the configuration of up to 100 authorized managers.

**Workaround:** Use the CLI command `ip authorized-managers help` to determine the maximum number of authorized managers that can be configured on the switch.

## NTP

### CR\_0000193443

**Symptom:** NTP debug configuration is incorrectly displayed in the output of the CLI command `show debug`.

**Scenario:** The NTP debug options enabled using the CLI command `debug NTP <packet | event>` are not correctly displayed in the output of the CLI command `show debug`.

## OOBM

### CR\_0000194019

**Symptom:** A switch with OOBM port may experience an NMI crash and reboot.

**Scenario:** When there is a broadcast storm on the OOBM network, the switch might encounter a crash with an error message similar to `NMI event <...> Task='tDevPollRx' <...>`.

**Workaround:** Avoid broadcast storms on the OOBM network.

## OpenFlow

### CR\_0000171815

**Symptom:** In rare circumstances, OpenFlow traffic might incorrectly be looped back to the switch.

**Scenario:** Repetitive enabling and disabling of OpenFlow while Service Insertion tunnels are removed and created, might lead to a condition where OpenFlow traffic could end up being looped back to the switch instead of being forwarded to its destination.

**Workaround:** Reboot the switch.

## PoE

### CR\_0000189058

**Symptom:** Rarely, a directly connected AP does not power up. The power LED on the AP remains unlit.

**Scenario:** Having dual Ethernet port Aruba APs connected to HPE Aruba Switches. Problem is commonly seen on 5400 V1 blades, but might rarely be seen on other HPE Aruba switches.

**Workaround:** Power can be restored by toggling PoE power to the connected port on the switch: `no int <port-nums> power` and `int <port-nums> power`.

### CR\_0000191040

**Symptom/Scenario:** Connecting both E0 & E1 ports on an Aruba AP325 to a POE ports on an HPE Aruba Switch results in a POE failure, loss of power on one of the switch ports, lighted switch fault LED and a `bad FET` message in the switch logs.

**Workaround:** Power can be restored to the affected port by unplugging the cable from it and perform a `poe-reset`. Alternately, unplugging the affected port and rebooting the switch will also restore power to the faulted ports. HPE recommends only E0 port of the AP plugs into the switch.

## SNMP

### CR\_0000192914

**Symptom:** SNMP community access violation warning messages are not always reported in the switch event log.

**Scenario:** When Authorized IP Managers are configured on the switch, SNMP access from unauthorized management stations with correct community names are not reported in the switch event log.

## Spanning Tree CR\_0000194044

**Symptom:** Traffic may be disrupted in an RPVST topology when VLAN configuration changes.

**Scenario:** In an RPVST topology, when there are ports configured for BPDU filter, PVST filter, and root guard, removing any VLAN from the switch configuration might cause traffic disruption in the network.

**Workaround:** Reapply all the configurations related to the root-guard, tcn-guard, bpdu-filter, and pvst-filter after removing VLAN.

## Supportability CR\_0000183389

**Symptom:** CLI command `show tech all` may fail to run properly.

**Scenario:** CLI command `show tech all` may not complete or execute properly.

## CR\_0000200816

**Symptom:** In some cases, the switch might halt or crash when executing the CLI command `show tech all`.

**Scenario:** A switch hang or crash might be encountered during execution of the CLI command `show tech all` while the switch is configured with policies applied to interfaces with the CLI command `policy {qos|pbr|mirror|zone} <policy-name>....`. The issue is intermittent and not every execution of `show tech all` causes a crash.

**Workaround:** Avoid executing `show tech all` if policies are applied to switch interfaces, or remove the policies from interfaces before executing `show tech all`.

## Switch Module CR\_0000198470

**Symptom:** A v3 switch module might crash with an error message similar to `Software exception at alloc_free.c <...> buf already freed <...>`.

**Scenario:** In cases of high traffic volume through a v3 switch module with traffic sampling enabled, if the switch needs to drop lot of the samples, the switch module might crash.

**Workaround:** Disable SFLOW using the CLI command `no sflow <INSTANCE>`.

## Trunking CR\_0000198822

**Symptom:** The switch does not accept the LACP key option to configure an LACP trunk.

**Scenario:** When executing CLI command `lacp key <0-65535>`, the switch returns the error message `Invalid input: key`.

# Upgrade information

## Upgrading restrictions and guidelines

WB.16.02.0025 uses BootROM WB.16.03. If your switch has an older version of BootROM, the BootROM will be updated with this version of software.

For more information about BootROM, see the *ArubaOS-Switch Management and Configuration Guide WB.16.02*.



**IMPORTANT:** During the software update, the switch will automatically boot twice. The switch will update the primary BootROM, then reboot, and then update the secondary BootROM. After the switch flash memory is updated and the final boot is initiated, no additional user intervention is needed. Do not interrupt power to the switch during this important update.

---

Firmware downgrade to a version earlier than 16.01 is not allowed if the max-vlans value is greater than 2048.

Unconfigure the max-vlans before attempting to downgrade from WB.16.02.0008 or later to a version earlier than 16.01 of the firmware.

For information on best practices when updating software or rolling back to previous versions of software, see the "Best practices for software updates" section of the *ArubaOS-Switch Basic Operations Guide Version 16.02*.

A Security Bulletin is the first published notification of security vulnerabilities and is the only communication vehicle for security vulnerabilities.

- Fixes for security vulnerabilities are not documented in manuals, release notes, or other forms of product documentation.
- A Security Bulletin is released when all vulnerable products still in support life have publicly available images that contain the fix for the security vulnerability.

## Finding Security Bulletins

### Procedure

1. Go to the HPE Support Center - Hewlett Packard Enterprise at [www.hpe.com/support/hpesc](http://www.hpe.com/support/hpesc).
2. Enter your product name or number and click **Go**.
3. Select your product from the list of results.
4. Click the **Top issues & solutions** tab.
5. Click the **Advisories, bulletins & notices** link.

## Security Bulletin subscription service

You can sign up at [http://www.hpe.com/support/Subscriber\\_Choice](http://www.hpe.com/support/Subscriber_Choice) to initiate a subscription to receive future Hewlett Packard Enterprise Security Bulletin alerts via email.

**Networking Websites**

**Hewlett Packard Enterprise Networking Information Library**

**[www.hpe.com/networking/resourcefinder](http://www.hpe.com/networking/resourcefinder)**

**Hewlett Packard Enterprise Networking Software**

**[www.hpe.com/networking/software](http://www.hpe.com/networking/software)**

**Hewlett Packard Enterprise Networking website**

**[www.hpe.com/info/networking](http://www.hpe.com/info/networking)**

**Hewlett Packard Enterprise My Networking website**

**[www.hpe.com/networking/support](http://www.hpe.com/networking/support)**

**Hewlett Packard Enterprise My Networking Portal**

**[www.hpe.com/networking/mynetworking](http://www.hpe.com/networking/mynetworking)**

**Hewlett Packard Enterprise Networking Warranty**

**[www.hpe.com/networking/warranty](http://www.hpe.com/networking/warranty)**

**General websites**

**Hewlett Packard Enterprise Information Library**

**[www.hpe.com/info/EIL](http://www.hpe.com/info/EIL)**

For additional websites, see **[Support and other resources](#)**.

## Accessing Hewlett Packard Enterprise Support

- For live assistance, go to the Contact Hewlett Packard Enterprise Worldwide website:  
<http://www.hpe.com/assistance>
- To access documentation and support services, go to the Hewlett Packard Enterprise Support Center website:  
<http://www.hpe.com/support/hpesc>

### Information to collect

- Technical support registration number (if applicable)
- Product name, model or version, and serial number
- Operating system name and version
- Firmware version
- Error messages
- Product-specific reports and logs
- Add-on products or components
- Third-party products or components

## Accessing updates

- Some software products provide a mechanism for accessing software updates through the product interface. Review your product documentation to identify the recommended software update method.
- To download product updates:
  - Hewlett Packard Enterprise Support Center**  
[www.hpe.com/support/hpesc](http://www.hpe.com/support/hpesc)
  - Hewlett Packard Enterprise Support Center: Software downloads**  
[www.hpe.com/support/downloads](http://www.hpe.com/support/downloads)
  - Software Depot**  
[www.hpe.com/support/softwaredepot](http://www.hpe.com/support/softwaredepot)
- To subscribe to eNewsletters and alerts:  
[www.hpe.com/support/e-updates](http://www.hpe.com/support/e-updates)
- To view and update your entitlements, and to link your contracts and warranties with your profile, go to the Hewlett Packard Enterprise Support Center **More Information on Access to Support Materials** page:



---

**IMPORTANT:** Access to some updates might require product entitlement when accessed through the Hewlett Packard Enterprise Support Center. You must have an HPE Passport set up with relevant entitlements.

---

## Customer self repair

Hewlett Packard Enterprise customer self repair (CSR) programs allow you to repair your product. If a CSR part needs to be replaced, it will be shipped directly to you so that you can install it at your convenience. Some parts do not qualify for CSR. Your Hewlett Packard Enterprise authorized service provider will determine whether a repair can be accomplished by CSR.

For more information about CSR, contact your local service provider or go to the CSR website:

<http://www.hpe.com/support/selfrepair>

## Remote support

Remote support is available with supported devices as part of your warranty or contractual support agreement. It provides intelligent event diagnosis, and automatic, secure submission of hardware event notifications to Hewlett Packard Enterprise, which will initiate a fast and accurate resolution based on your product's service level. Hewlett Packard Enterprise strongly recommends that you register your device for remote support.

If your product includes additional remote support details, use search to locate that information.

### Remote support and Proactive Care information

#### HPE Get Connected

[www.hpe.com/services/getconnected](http://www.hpe.com/services/getconnected)

#### HPE Proactive Care services

[www.hpe.com/services/proactivecare](http://www.hpe.com/services/proactivecare)

#### HPE Proactive Care service: Supported products list

[www.hpe.com/services/proactivecaresupportedproducts](http://www.hpe.com/services/proactivecaresupportedproducts)

#### HPE Proactive Care advanced service: Supported products list

[www.hpe.com/services/proactivecareadvancedsupportedproducts](http://www.hpe.com/services/proactivecareadvancedsupportedproducts)

### Proactive Care customer information

#### Proactive Care central

[www.hpe.com/services/proactivecarecentral](http://www.hpe.com/services/proactivecarecentral)

#### Proactive Care service activation

[www.hpe.com/services/proactivecarecentralgetstarted](http://www.hpe.com/services/proactivecarecentralgetstarted)

## Warranty information

To view the warranty for your product or to view the *Safety and Compliance Information for Server, Storage, Power, Networking, and Rack Products* reference document, go to the Enterprise Safety and Compliance website:

[www.hpe.com/support/Safety-Compliance-EnterpriseProducts](http://www.hpe.com/support/Safety-Compliance-EnterpriseProducts)

### Additional warranty information

#### HPE ProLiant and x86 Servers and Options

[www.hpe.com/support/ProLiantServers-Warranties](http://www.hpe.com/support/ProLiantServers-Warranties)



## HPE Enterprise Servers

[www.hpe.com/support/EnterpriseServers-Warranties](http://www.hpe.com/support/EnterpriseServers-Warranties)

## HPE Storage Products

[www.hpe.com/support/Storage-Warranties](http://www.hpe.com/support/Storage-Warranties)

## HPE Networking Products

[www.hpe.com/support/Networking-Warranties](http://www.hpe.com/support/Networking-Warranties)

# Regulatory information

To view the regulatory information for your product, view the *Safety and Compliance Information for Server, Storage, Power, Networking, and Rack Products*, available at the Hewlett Packard Enterprise Support Center:

[www.hpe.com/support/Safety-Compliance-EnterpriseProducts](http://www.hpe.com/support/Safety-Compliance-EnterpriseProducts)

## Additional regulatory information

Hewlett Packard Enterprise is committed to providing our customers with information about the chemical substances in our products as needed to comply with legal requirements such as REACH (Regulation EC No 1907/2006 of the European Parliament and the Council). A chemical information report for this product can be found at:

[www.hpe.com/info/reach](http://www.hpe.com/info/reach)

For Hewlett Packard Enterprise product environmental and safety information and compliance data, including RoHS and REACH, see:

[www.hpe.com/info/ecodata](http://www.hpe.com/info/ecodata)

For Hewlett Packard Enterprise environmental information, including company programs, product recycling, and energy efficiency, see:

[www.hpe.com/info/environment](http://www.hpe.com/info/environment)

# Documentation feedback

Hewlett Packard Enterprise is committed to providing documentation that meets your needs. To help us improve the documentation, send any errors, suggestions, or comments to Documentation Feedback ([docsfeedback@hpe.com](mailto:docsfeedback@hpe.com)). When submitting your feedback, include the document title, part number, edition, and publication date located on the front cover of the document. For online help content, include the product name, product version, help edition, and publication date located on the legal notices page.