

WB.15.14.0012 Release Notes

Abstract

This document contains supplemental information for the WB.15.14.0012 release.

HP Part Number: 5998-8038
Published: May 2015
Edition: 1



© Copyright 2015 Hewlett-Packard Development Company, L.P.

Confidential computer software. Valid license from HP required for possession, use or copying. Consistent with FAR 12.211 and 12.212, Commercial Computer Software, Computer Software Documentation, and Technical Data for Commercial Items are licensed to the U.S. Government under vendor's standard commercial license.

The information contained herein is subject to change without notice. The only warranties for HP products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. HP shall not be liable for technical or editorial errors or omissions contained herein.

Acknowledgments

Microsoft®, Windows®, and Windows Server® are trademarks of the Microsoft group of companies.

Contents

1 WB.15.14.0012 Release Notes.....	6
Description.....	6
Important information.....	6
Version history.....	6
Products supported.....	8
Compatibility/interoperability.....	8
Minimum supported software versions.....	8
Enhancements.....	8
Version WB.15.14.0012.....	8
Version WB.15.14.0011.....	8
Version WB.15.14.0010.....	8
Version WB.15.14.0009.....	8
Version WB.15.14.0008.....	8
Version WB.15.14.0007.....	8
Additional Debug Capability	8
Version WB.15.14.0006.....	8
Version WB.15.14.0005.....	9
Version WB.15.14.0004.....	9
Version WB.15.14.0003.....	9
Version WB.15.14.0002.....	9
Certificate Manager	9
Chassis Locate LED	9
DHCPv4 Snooping	9
FIPS Upgrade	9
Filtering PVID Mismatch	9
LACP-MAD	9
Local MAC Authentication	9
OpenFlow	10
Smartlink	10
SNMP Trap	10
Fixes.....	10
Version WB.15.14.0012.....	10
802.1X.....	10
Certificate Manager.....	10
CLI.....	10
Crash.....	11
OpenFlow.....	11
PIM.....	11
PoE.....	11
Port Connectivity.....	11
QoS.....	11
SSH.....	11
SSL.....	11
Version WB.15.14.0011.....	11
Certificate Manager.....	11
CLI.....	12
Crash.....	12
Memory.....	12
Redundant Management.....	12
SSH.....	12
TFTP.....	13

Version WB.15.14.0010.....	13
ARP.....	13
CLI.....	13
Config.....	13
Counters.....	13
Crash.....	13
File Transfer.....	14
ICMP.....	14
IP Phones.....	14
LLDP/PoE	14
Memory.....	15
Meshing.....	15
Redundant Management.....	15
Routing.....	15
Smart Link.....	15
Stacking.....	15
Switch Hang.....	15
TACACS.....	15
Version WB.15.14.0009.....	15
802.1X	15
CLI	15
Config	16
sFlow	16
SNMP	16
Switch Hang.....	16
Version WB.15.14.0008.....	16
Crash	16
Version WB.15.14.0007.....	16
Authentication	16
BPDU Protection	16
CLI	16
Console	17
Crash	17
IPv6.....	17
Logging.....	17
Management	17
OpenFlow	17
PoE	17
sFlow	17
SNMP.....	18
Stacking	18
Switch Hang.....	18
TELNET.....	18
Web Management	18
Version WB.15.14.0006.....	18
CLI	18
Config	18
Console.....	19
Counters.....	19
Crash	19
Display Issue	19
Fastboot	20
IGMP	20
IP Phones	20
Logging	20

Meshing	20
MSTP	20
Multicast	20
RADIUS	20
Spanning Tree	20
Transceivers.....	21
Version WB.15.14.0005.....	21
Version WB.15.14.0004.....	21
Crash.....	21
Logging.....	21
RADIUS.....	21
Spanning Tree.....	21
Version WB.15.14.0003.....	21
Version WB.15.14.0002.....	21
802.1X	21
Authentication	22
CLI.....	22
Config.....	22
Crash.....	22
DHCP.....	23
Event Log	23
GVRP.....	23
ICMP.....	23
IGMP.....	23
Jumbo Frames	23
Link	23
Loop Protection.....	23
MAC Authentication.....	23
OpenFlow.....	24
Passwords	24
Policy Based Routing	24
RADIUS Accounting.....	24
Routing.....	24
sFlow.....	24
SNMP.....	24
SSL.....	24
TFTP	24
Transceivers.....	24
Trunking.....	25
Uplink Failure Detection	25
Web Management	25
Upgrade information.....	25
Upgrading restrictions and guidelines.....	25
Contacting HP.....	25
HP security policy.....	25
Related information.....	26
Documents.....	26
Websites.....	26
Documentation feedback.....	26

1 WB.15.14.0012 Release Notes

Description

This release note covers software versions for the WB.15.14 branch of the software.

Version WB.15.14.0002 was the initial release of Major version WB.15.14 software.

WB.15.14.0002 software was built from the same source as WB.15.13.0003. WB.15.14.0002 includes all enhancements and fixes in WB.15.13.0003 software, plus the additional enhancements and fixes in the WB.15.14.0002 enhancements and fixes sections of this release note.

Product series supported by this software:

- HP 2920 Switch Series

Important information

To avoid damage to your equipment, do not interrupt power to the switch during the software update.

Version history

All released versions are fully supported by HP, unless noted in the table.

Version number	Release date	Based on	Remarks
WB.15.14.0012	2015-04-17	WB.15.14.0011	Released, fully supported, and posted on the web.
WB.15.14.0011	2015-02-06	WB.15.14.0010	Released, fully supported, and posted on the web.
WB.15.14.0010	2015-01-07	WB.15.14.0009	Released, fully supported, and posted on the web.
WB.15.14.0009	2014-09-15	WB.15.14.0008	Released, fully supported, and posted on the web.
WB.15.14.0008	2014-07-16	WB.15.14.0007	Released, fully supported, but not posted on the web.
WB.15.14.0007	2014-07-01	WB.15.14.0006	Released, fully supported, and posted on the web.
WB.15.14.0006	2014-03-27	WB.15.14.0002	Released, fully supported, but not posted on the web.
WB.15.14.0005	n/a		Never built.
WB.15.14.0004	2014-01-07	WB.15.14.0002	Released, fully supported, but not posted on the web.
WB.15.14.0003	n/a		Never built.
WB.15.14.0002	2013-10-18	WB.15.13.0003	Initial release of WB.15.14, fully supported, and posted on the web for early availability.
WB.15.13.0014	2014-11-17	WB.15.13.0013	Please see the WB.15.13.0014 release note for detailed information on the WB.15.13 branch. Released, fully supported, and posted on the web.
WB.15.13.0013	2014-09-15	WB.15.13.0012	Released, fully supported, and posted on the web.

Version number	Release date	Based on	Remarks
WB.15.13.0012	2014-07-31	WB.15.13.0011	Released, fully supported, but not posted on the web.
WB.15.13.0011	n/a	WB.15.13.0010	Never released.
WB.15.13.0010	n/a	WB.15.13.0009	Never released.
WB.15.13.0009	n/a	WB.15.13.0008	Never released.
WB.15.13.0008	2014-05-29	WB.15.13.0006	Released, fully supported, and posted on the web.
WB.15.13.0007	2014-03-31	WB.15.13.0006	Released, fully supported, but not posted on the web.
WB.15.13.0006	2014-03-21	WB.15.13.0005	Released, fully supported, but not posted on the web.
WB.15.13.0005	2013-12-20	WB.15.13.0004	Released, fully supported, and posted on the web.
WB.15.13.0004	2013-08-28	WB.15.13.0003	Released, fully supported, but not posted on the web.
WB.15.13.0003	2013-07-02	WB.15.12.0006	Initial release of WB.15.13, fully supported, and posted on the web for early availability.
WB.15.12.0016	2014-10-06	WB.15.12.0015	Please see the WB.15.12.0015 release note for detailed information on the WB.15.12 branch. Released, fully supported, but not posted on the web.
WB.15.12.0015	2014-03-13	WB.15.12.0014	Released, fully supported, and posted on the web.
WB.15.12.0014	2014-01-17	WB.15.12.0013	Released, fully supported, and posted on the web.
WB.15.12.0013	2013-11-20	WB.15.12.0012	Released, fully supported, but not posted on the web.
WB.15.12.0012	2013-11-05	WB.15.12.0011	Released, fully supported, but not posted on the web.
WB.15.12.0011	2013-10-10	WB.15.12.0010	Released, fully supported, but not posted on the web.
WB.15.12.0010	2013-08-13	WB.15.12.0008	Released, fully supported, and posted on the web.
WB.15.12.0009	n/a		Never built.
WB.15.12.0008	2013-06-25	WB.15.12.0007	Released, fully supported, but not posted on the web.
WB.15.12.0007	2013-03-26	WB.15.12.0006	Released, fully supported, but not posted on the web.
WB.15.12.0006	2013-02-28	First release	Initial release of WB.15.12, fully supported, but not posted on the web.

Products supported

This release applies to the following product models:

Product number	Description
J9726A	HP 2920-24G Switch
J9728A	HP 2920-48G Switch
J9727A	HP 2920-24G-PoE+ Switch
J9729A	HP 2920-48G-PoE+ Switch
J9836A	HP 2920-48G-PoE+ 740W Switch

Compatibility/interoperability

Minimum supported software versions

Product number	Product Name	Minimum Supported Software Version
J9805A	HP 640 Redundant/External PS Shelf	WB.15.13.0003

Enhancements

This section lists enhancements found in the WB.15.14 branch of the software. Software enhancements are listed in reverse-chronological order, with the newest on the top of the list. Unless otherwise noted, each software version listed includes all enhancements added in earlier versions.

NOTE: The number that precedes the enhancement description is used for tracking purposes.

Version WB.15.14.0012

No enhancements were included in version WB.15.14.0012.

Version WB.15.14.0011

No enhancements were included in version WB.15.14.0011.

Version WB.15.14.0010

No enhancements were included in version WB.15.14.0010.

Version WB.15.14.0009

No enhancements were included in version WB.15.14.0009.

Version WB.15.14.0008

No enhancements were included in version WB.15.14.0008.

Version WB.15.14.0007

Additional Debug Capability

CR_0000132845 This enhancement adds tracking to identify possible switch hang situations during switch boot.

Version WB.15.14.0006

No enhancements were included in version WB.15.14.0006.

Version WB.15.14.0005

WB.15.14.0005 was never built.

Version WB.15.14.0004

No enhancements were included in version WB.15.14.0004.

Version WB.15.14.0003

WB.15.14.0003 was never built.

Version WB.15.14.0002

Certificate Manager

CR_0000115812 Certificate Manager. Certificate Manager enables Public Key Infrastructure (PKI) capability on the switch providing authentication of network entities. See "Certificate Manager" in the *Access Security Guide* for your switch.

Chassis Locate LED

CR_0000134999 Chassis Locate LED at Boot. The `chassislocate` command has an optional parameter that configures it to run in the future instead of immediately. See "Troubleshooting" in the *Management and Configuration Guide* for your switch.

DHCPv4 Snooping

CR_0000129524 DHCPv4 Snooping Max Binding. DHCP snooping max-binding prevents binding entries from getting exhausted. This feature is on a per-port basis and restricts the maximum number of bindings allowed on a port/interface. The maximum bindings for a particular port includes both statically configured and dynamically learned. The number of bindings on a per port basis is incremented upon a lease offer and decremented upon a lease expiry or release. See "Port Security" in the *Access Security Guide* for your switch.

FIPS Upgrade

CR_0000140539 FIPS Mocana 5.7 Upgrade. The internal security/cryptography code has been improved to prevent circumvention. This does not affect YB-software.

Filtering PVID Mismatch

CR_0000127014 Filtering PVID Mismatch Log Messages. This enhancement filters out PVID mismatch log messages on a per-port basis. PVID mismatches are logged when there is a difference in the PVID advertised by a neighboring switch and the PVID of the switch port which receives the LLDP advertisement. However, if these events are logged too frequently, they can overwhelm the log buffer and push relevant logging data out of log memory, making it difficult to troubleshoot another issue. See "Troubleshooting" in the *Management and Configuration Guide* for your switch.

LACP-MAD

CR_0000127160 Link Aggregation Control Protocol-Multi-Active Detection (LACP-MAD). Link Aggregation Control Protocol-Multi-Active Detection (LACP-MAD) is a detection mechanism deployed by switches to recover from a breakup of the Intelligent Resilient Framework (IRF) stack due to link or other failure. See "Port Trunking" in the *Management and Configuration Guide* for your switch.

Local MAC Authentication

CR_0000128955 Local MAC Authentication (LMA). LMA is a software feature that simplifies deployment for devices such as IP phones and security cameras. In general, it provides dynamic attribute assignment (e.g., VLAN and QoS) through the use of a locally configured authentication repository. The most common use model for LMA is to automatically assign a VLAN to IP phones.

In some cases, it can also provide rudimentary access security for the network. See "Web and MAC Authentication" in the *Access Security Guide* for your switch.

OpenFlow

CR_0000138355 OpenFlow 1.3 Support. OpenFlow controllers can securely connect to HP VAN SDN Controllers via a set of commands that establish and maintain the security certification. See the *OpenFlow Administrator's Guide* for your switch.

Smartlink

CR_0000131581 Smartlink. Smartlink is a switch feature that provides effective, simple and fast-converging link redundancy in network topology with dual uplink between different layers of the network. It requires an active (master) and a backup (slave) link. The active link carries the uplink traffic. Upon failure of the active link, a switchover is triggered and the traffic is directed to the backup link. See "Smartlink" in the *Advanced Traffic Management Guide* for your switch.

SNMP Trap

CR_0000135708 SNMP Trap When MAC Address Table Changes. This enhancement causes an SNMP trap to be generated once a laptop/PC is removed from the back of an IP phone and the laptop/PC MAC address ages out of the MAC table. See "Configuring for Network Management Applications" in the *Management and Configuration Guide* for your switch.

Fixes

Software fixes are listed in reverse-chronological order, from newest to oldest software version. Unless otherwise noted, each software version listed below includes all the software fixes and enhancements added in previous versions listed below.

NOTE: The number preceding the fix description is used for tracking purposes.

Version WB.15.14.0012

802.1X

CR_0000164489 802.1x re-authentication period works if the client connects after the switch is booted. If, however, the switch reboots while clients are connected, it authenticates initially, but no re-authentication occurs.

Certificate Manager

CR_0000164093 When an IDEVID certificate is being used to establish TLS connections with a CNM server, the existing signature algorithm has been updated from SHA-1 to DER, with new root certificate for the RA server.

CLI

CR_0000163218 The output of the CLI command `show interface ethernet <interface>` becomes misaligned when the value of `Total Rx (bps)` reaches 100,000,000. When the 9th digit is added to the value of `Total Rx`, the adjacent line in the output (`Total Tx (bps)`) is shifted one column farther.

CR_0000163219 After issuing the CLI command `clear statistics global`, two problems might appear in the output of `show interface ethernet <port ID>`:

1. The values of `Bytes Rx` and `Bytes Tx` are no longer displayed as comma-separated values. This applies to counter values from 2,147,483,647 through 4,294,967,295. Other counters

than the number of bytes sent and received also appear to be affected by the same display issue (for example, Unicast counters and Deferred Tx).

2. After entering `clear stat global`, the format of the output of `show interface ethernet <port>` shifts two places. The missing space might appear at Giant Rx – Late Collisions, but where the space is added seems can differ.

Crash

CR_0000154769 The switch may reboot unexpectedly when the management interface is accessed via SSH and the `show tech all` CLI command is executed, or when the SSH session is idle following execution of the CLI command `show run` a few minutes earlier.

OpenFlow

CR_0000162736 When adding a rule entry to OpenFlow, a `TABLE_FULL ECodeFlowModeFailed` error can occur, even when there is space for additional rules.

PIM

CR_0000156038 The multicasts are flooded, causing a behavior equal to a broadcast storm, which causes high CPU utilization when pim-sparse neighbors are configured.

PoE

CR_0000146605 All the ports on a module fail to deliver power when a single controller fails.

Port Connectivity

CR_0000161856 If `ip igmp static-group <group-address>` is added to the switch configuration for any VLAN, then upon a warm or cold reboot of the switch, the switch does not establish a link on any Ethernet ports. This issue is also present on stand-alone 2920, with stacking disabled.

QoS

CR_0000162179 When attempting to remove a configuration line from a QoS policy, the switch returns `commit failed`. The customer cannot delete the line and has to reload the configuration to recover. Occurs when multiple policies are configured.

SSH

CR_0000165393 When the SSH client has a keepalive mechanism configured that requires a response from the SSH server on the switch, the SSH client will terminate the session after the first keepalive packet is transmitted. This happens because the switch drops the client's keepalive packet due to an incorrect packet length calculation.

This issue has been observed using an openSSH client with the `ServerAliveInterval` configured and the parameter `'want_reply'` enabled.

SSL

CR_0000162587 SSL Security vulnerability due to 56 bit DES-CBC-SHA. Due to security vulnerability the cipher DES-CBC-SHA is now unavailable.

Version WB.15.14.0011

Certificate Manager

CR_0000159204 When a self-signed certificate is generated in the CLI, the certificate does not contain a valid start and end-date. This causes the certificate to be invalid, which causes problems establishing HTTPS sessions or using syslog over TLS. When the self-signed certificate is generated in the web interface, this problem does not occur.

CLI

CR_0000156237 When a user enables Spanning Tree in the CLI and configured a protocol version other than the default MSTP, the CLI Menu does not allow the user to modify Spanning Tree parameters. The menu indicates that the switch requires a reboot. When the switch is actually rebooted, the same problem is present after the reboot.

CR_0000161668 After a user changes the Spanning Tree Protocol Version to RPVST in the CLI Menu, the switch prompts the user to save the configuration and reboot the system to activate the changes. However, after saving and rebooting, those messages continue to be displayed.

Crash

CR_0000149153 When an exceptionally large amount of IP Address Manager (IPAM) output is generated by the `show tech all` command and captured using the `copy command-output CLI` command, the system might crash with the following message: `NMI event SW:IP=0x00147168 MSR:0x02029200 LR:0x00120f7c cr: 0x44000400 sp:0x04d60f30 xer:0x00000000 Task='mSess3' Task ID=0x4d59728.`

CR_0000155066 The switch might reboot unexpectedly with a Software Exception message similar to: `Software exception at stackingFile.c:2224 -- in 'mStackDatWriter', task ID = 0x3c953b00 -> Internal Error ID: 6382d706)` when a lot of TFTP file transfers to an external TFTP server occur.

CR_0000159646 After enabling Control Plane Protection on a system that contains a module or stack member switch that has less than 24 ports, all modules in a chassis or all stack member switches crash repeatedly with the following message: `Software exception at aqTcamSlaveUtils.c:2056 -- in 'mAsicUpd', task ID = 0x1b1e6780 -> Policy Engine: Port instance not on this slot.`

CR_0000159764 Due to a semaphore deadlock with an unknown trigger, a switch might crash with a message similar to: `NMI event HW:IP=0x0151dec4 MSR:0x02029200 LR:0x0151e468 cr: 0x20000800 sp:0x02f01460 xer:0x20000000 Task='tDevPollRx' Task ID=0xaa28000.`

CR_0000162400 When the switch continuously attempts to transfer a file to a destination that returns an error; for example, because it ran out of space to store the file, the switch might eventually crash with the message: `Software exception at hwBp.c:218 -- in 'fault_handler', task ID = 0x3c403380 -> MemWatch Trigger: Offending task 'mftTask'.`

Memory

CR_0000150414 After a Flare OpenFlow controller sends flow modification packets to a switch that contained invalid zero-length action headers, the switch becomes unresponsive and eventually crashes with the following message: `NMI event SW:IP=0x09f4e6ec MSR:0x02029200 LR:0x09f4efe4 cr: 0x88000800 sp:0x130ad738 xer:0x20000000 Task='eOFNetTask' Task ID=0x130add28.`

Redundant Management

CR_0000149253 When a switch stack or chassis with redundant management modules is rebooted, the system might not finish booting properly. The modules in the chassis or the stack member switches will appear to have completed the boot process, but all their ports remain down.

SSH

CR_0000153145 When a user copies a large file from the switch to a server using the SFTP client on the switch, the file transfer might be prematurely interrupted because the session disconnects before the file transfer has been completed. When this occurs, the following message is recorded in the system's Event log: `03311 sftp: AM1: User: SFTP connection failure while connecting from <ip address>.`

TFTP

CR_0000159058 When the switch is used as a TFTP server and configuration files are transferred from the switch to an external TFTP client, the software creates a temporary file in memory that is removed after the transfer has completed. However, the temporary file is not deleted when an error occurs during the file transfer. When repeated file transfers of configuration files fail, the temporary files accumulate and might deplete the available memory space. Once depleted, further file transfers fail and the switch might reboot unexpectedly (crash). Note that when the switch is rebooted, all temporary files are removed from memory.

Version WB.15.14.0010

ARP

CR_0000152907 Changing the **ip arp-age** value should apply to existing ARP cache entries, but it does not.

CLI

CR_0000145136 When the switch is configured with the **console event critical** setting, the event log output of `show tech all` lists only the critical events. With this fix, `show tech all` lists all event log entries.

CR_0000152440 The output of `show tech all` halts while displaying **lmaDbUtil traverseLmaProfTbl**, with the message `=== The command has completed with errors. ===`.

Config

CR_0000145221 The switch prompts users to save the configuration when no changes have been made. This has been observed after configuring meshing, saving the config, and rebooting the switch.

CR_0000152418 Routing must be enabled before the Local Proxy-ARP feature can be configured, but when routing is removed from the config, the Local Proxy-ARP configuration is not removed.

Counters

CR_0000148671 The output of `show ip counters ipv6` gives incorrect values.

Crash

CR_0000146176 After receiving multiple route changes or route flaps in a short period of time, the switch might reboot unexpectedly with a message similar to `Software exception at krt.c:2134 -- in 'eRouteCtrl', task ID = 0xa9bc400 -> Routing Stack: Assert Failed`.

CR_0000151102 In a rare situation, after a failover to the Standby Management Module (SMM) or the stack's Standby switch, the switch might reboot unexpectedly with a message similar to `Software exception at asicMgrSlaveFilters.c:185 -- in 'mNSA', task ID = 0x1b1fea80 -> Internal Name Server Error`.

CR_0000152930 After deleting the last of any configured Smart Link groups, the switch might reboot unexpectedly.

CR_0000153035 With MAC-based authentication and mixed-mode enabled on a port that has both authenticated and unauthenticated clients, a redundancy failover might cause the switch to reboot unexpectedly with a message similar to `Software exception at btthwSrcBasedVlan.c:263 -- in 'mAdMUpCtrl', task ID = 0x1fecc6c0 -> ASSERT: failed`.

CR_0000153386 When a large number of 802.1X clients are being authenticated, reconfiguring port security modes such as **learn-mode** might cause the switch to reboot unexpectedly with a

message similar to Software exception at multMgmtUtil.c:88 -- in 'mPpmgrCtrl', task ID = 0x13b1f940 -> Internal error.

CR_0000154230 When copying a coredump from standby management module (SMM) or the stack's standby switch to a server via SCP, the switch might reboot unexpectedly with a message similar to hwBp.c:218 -- in 'fault_handler', task ID = 0x3c402380 -> MemWatch Trigger: Offending task 'mRfsCtrl'. Offending IP=0xa9712f0.

CR_0000154602 The switch experiences a loss of free memory for failed PEAP-MSCHAPv2 MAC-based authentication requests. When memory is no longer available, the switch reboots unexpectedly with a message similar to Software exception at wma_peap.c:713 -- in 'mWebAuth', task ID = 0x1de85340 -> ASSERT: failed.

CR_0000155359 Enabling the arp-protect command on 4094 VLANs causes CPU utilization to increase to 100%.

CR_0000155538 Disabling and re-enabling a port configured for Web or MAC-authentication during client authentication might cause the switch to reboot unexpectedly with a message similar to Health Monitor: Restr Mem Access HW Addr=0xb1ba0c1a IP=0x108682b8 Task='mWebAuth' Task ID=0x1de8c680 sp:0x12f98530 lr:0x10868664 msr: 0x0000b032 xer: 0x00000000 cr: 0x88000400.

CR_0000155604 When a CLI command is entered with a backslash as the last character and then the repeat command is issued, the switch might reboot unexpectedly with a message similar to Task mSess1 encountered an exception.

CR_0000155710 Sending an ICMPv6 echo request packet with multiple fragment headers to the switch causes an NMI crash.

CR_0000155750 When using MAC Authentication on 2620, the following software exception may occur: wma_client_sm.c:1646 -- in 'mWebAuth', task ID = 0x1de85380.

CR_0000156908 A banner configured with more than 1048 characters causes the switch to go into a continuous "boot loop" when the switch is rebooted. The switch logs a message similar to Health Monitor: Invalid Instr Misaligned Mem Access HW Addr=0x54202800 IP=0x54202800 Task='swInitTask' Task ID=0xaa1a840 sp:0x2e288a0 lr:0x54202800 msr: 0x02029200 xer: 0x20000000 cr: 0x44000400.

File Transfer

CR_0000148584 A configuration file with a blank community name in the **snmp-server host** entry cannot be downloaded to the switch. Although the switch does not allow the **snmp-server host** entry to be configured with a blank community name, earlier software bugs might cause this condition.

CR_0000153959 The core dump file cannot be transferred from the switch to an external device.

ICMP

CR_0000155702 The switch sends a ping request to a random IP address every 20 minutes.

IP Phones

CR_0000157298 If an IP phone sends the switch an invalid power value of zero watts in an LLDP-MED TLV, the switch log shows PD Over Current indication and the phone might continuously reboot. This has been observed with the Avaya 9641G IP phone.

LLDP/PoE

CR_0000156145 2920 Stack with non-PoE commander fails LLDP negotiation of power management for POE.

Memory

CR_0000152126 Issuing the `terminal length` or `terminal width` command causes a small loss of free memory.

Meshing

CR_0000155857 Enabling meshing and then configuring IGMP, causes error message: `W 08/12/14 10:56:52 02413 igmp: Internal api IgmpInterface_getPortMode failed: bad port mode.`

Redundant Management

CR_0000155089 Issuing the `erase all` command on a switch configured for **redundancy management-module nonstop-switching** might cause the Standby Management Module (SMM) or the stack's standby switch to reboot continuously.

CR_0000156759 After redundancy switchover with `boot` command when modules have not finished booting, an internal buffer may become corrupted. This could possibly lead to a crash.

Routing

CR_0000155524 After issuing the `clear arp` command, traffic that is destined for the default router is routed via software, which causes poor performance.

Smart Link

CR_0000152346 Upstream switches do not flush the MAC and ARP entries after a Smart Link switchover.

CR_0000152422 After deleting the active Master port from a Smart Link group, the Slave port takes over but does not send flush packets.

CR_0000152432 When Spanning Tree is enabled after Smart Link is configured, the Smart Link ports incorrectly take part in Spanning Tree.

Stacking

CR_0000154380 A failover from Commander to Standby with multiple MSTP instances in operation might cause the stack members and connected devices to be unreachable.

Switch Hang

CR_0000154477 Attempting to apply a 32-character **local-mac profile** name to a 32-character **local-mac mac-group** name causes the switch to become unresponsive, requiring a reboot to recover.

TACACS

CR_0000155541 TACACS authentication is not working with encrypt credentials in FIPS devices.

Version WB.15.14.0009

802.1X

CR_0000149780 Already-authenticated clients that send an EAPOL-Start message are de-authenticated by the switch. This situation happens if the client runs Windows Vista and later operating systems that are set to "include learning".

CLI

CR_0000152183 The output of `show tech all` halts while displaying `hw aqread 0 8191 pbf cm`, with the message `=== The command has completed with errors. ===`.

Config

CR_0000149526 Enabling stacking on a switch that has a trunk configured creates an invalid entry for the trunk in the config file. The resulting configuration file cannot be downloaded to the switch.

sFlow

CR_0000152330 sFlow samples of packets transmitted by the switch have an incorrect value (0x3ffffff) for the output port.

SNMP

CR_0000154463 The switch incorrectly reports that MIB object entPhysicalsFRU = False for transceivers for some switches. This improves the original SNMP fix (CR_0000151035).

Switch Hang

CR_0000154152 If the switch is sending output to the console at the time the switch is rebooted, the switch might hang and not boot properly.

Version WB.15.14.0008

Crash

CR_0000152222 With multiple authentication protocols active in a high-stress environment, the switch might reboot unexpectedly with a message similar to `NMI event HW:IP=0x0103191c MSR:0x02029200 LR:0x00121208 cr: 0x20000800 sp:0x02d56220 xer:0x20000000 Task='tDevPollRx' Task ID=0x2d3fc78.`

Version WB.15.14.0007

Authentication

CR_0000148832 A switch configured with RADIUS authentication for primary login, and local authentication for secondary login fails to use local authentication when RADIUS servers do not respond. In that situation, the switch console is not accessible to valid users. This fix was inadvertently omitted from the original WB.15.14.0007 fix list.

BPDU Protection

CR_0000144148 If VLAN 1 is not enabled on the link between a switch running rapid PVST and a switch running any Spanning Tree version, a rapid PVST switch configured for BPDU protection does not shut down the port when it receives a BPDU from the neighboring switch. However, the BPDUs are correctly dropped. This fix was inadvertently omitted from the original WB.15.14.0007 fix list.

CLI

CR_0000142154 The output of `show tech` halts after displaying `show debug buffer`, with the message `=== The command has completed with errors. ===`.

CR_0000145812 A new command `tcp-push-preserve` is added. This command is enabled by default, and causes TCP packets with the "push" flag to be sent before other packets in the queue. Note that high concentrations of TCP packets with push flags under certain conditions can destabilize your network. Use the `no` form of this command to disable the feature..

CR_0000148661 When the output of `show power-over-ethernet brief` displays a Detection Status of either Searching or Delivering for a port, the `show tech all "poe_status_port all"` section displays Other Fault as the Detect Stat.

CR_0000149525 The switch incorrectly allows a user to enable stacking when more than four MSTP instances are configured.

CR_0000150144 The output of `show dhcp-relay bootp-gateway vlan <VLAN_number>` gives an incorrect BOOTP Gateway address for VLANs that are not configured for DHCP relay.

Console

CR_0000148468 With a console cable connected to a stack member, if the user issues the `show tech all` command and then attempts to cancel the output by entering `<CTRL-C>`, the output pauses but then continues for a long time (up to 30 minutes for a five-member stack). Note that the fix has a small side-effect: Entering `<CTRL-C>` will cause a short delay before the console prompt returns.

Crash

CR_0000147367 After a PoE switch is removed from the stack, issuing the command `show power-over-ethernet brief` from the Commander might cause the Commander to reboot unexpectedly with a message similar to Health Monitor: Read Error Restr Mem Access HW Addr=0x9f6a5cf8 IP=0x7d27d78 Task='mSess1' Task ID=0x13ac6900 fp: 0x0d8544d8 sp:0x0d8544cc cpsr: 0xa000001f.

IPv6

CR_0000148594 IPv6 Router Advertisements that indicate an off-link prefix are not set as "preferred" in the switch, which causes incorrect information in the output of `show ipv6`, and can affect connectivity to hosts that use IPv6 Stateless Address Autoconfiguration. This issue also causes the sFlow "Agent Address" to be listed as 0.0.0.0.

Logging

CR_0000146773 In an IPv4 plus IPv6 environment, upon switch bootup the event log displays the set of source IP policy ("srcip") messages twice. With this fix, IPv6 policy messages are distinguished from IPv4 policy messages.

CR_0000150244 Some RMON events are not correctly defined for fault-finder (FFI), SSL, and virus throttling, which causes the switch to report an error such as `system: Unknown Event ID 776` when those events occur.

Management

CR_0000149528 In some situations with multiple TELNET and/or SSH sessions established, the switch does not accept additional management sessions even if some of the existing ones are killed, responding with the message `Sorry, the maximum number of sessions are active. Try again later.`

OpenFlow

CR_0000142663 The switch sends an error message to the controller in response to a multipart flow statistics request.

PoE

CR_0000147518 After reboot, pre-standard detection of PoE devices does not function correctly on a 2920 or 3800 stack, if the stack commander is a non-PoE switch.

CR_0000148808 After disabling PoE on one or more ports, the output of `show cpu slot <slot-number>` shows an increase in CPU utilization of 15% or more.

sFlow

CR_0000147660 In an IPv6-only environment with Stateless Address Autoconfiguration, sFlow incorrectly uses the link-local address as the agent ID.

SNMP

CR_0000147370 After using SNMP to configure a RADIUS server on the switch, the switch does not allow a login until the switch is rebooted.

CR_0000149657 When using the "createAndWait" mode to set parameters via SNMP, multiple RADIUS servers cannot be configured.

CR_0000151035 The switch incorrectly reports that MIB object `entPhysicalIsFRU` = False for removable fantrays and transceivers.

Stacking

CR_0000146890 When the stacking cable is removed from a two-switch stack, both switches show "Stack Status" of `Fragment Active`.

Switch Hang

CR_0000146247 With both authentication and accounting enabled, the switch might become unresponsive to management, requiring a reboot to recover.

TELNET

CR_0000142571 While a user is being authenticated by a RADIUS server, issuing the `show access-list radius all` command from a TELNET session might cause the TELNET session to hang.

Web Management

CR_0000149099 When Spanning Tree Protocol (STP) is enabled via the Web user interface, "mstp" is shown as the default STP mode, and "mstp" is displayed as the operational mode after the user enables STP and saves the change. However, the command line interface shows that the switch operates in "rpvst" mode. Workaround: From the Web user interface, use the dropdown menu to explicitly select "mstp" from the dropdown options, then save the change.

Version WB.15.14.0006

CLI

CR_0000141831 The output of `show system temperature` gives incorrect and extra information. With this fix, the switch output displays `Chassis` instead of `Sys-1`, the correct threshold is displayed, and extra lines (for example, `Sys-2`) are removed.

CR_0000143576 The switch does not allow users to configure a port with the setting `speed-duplex auto-10-100`.

CR_0000143652 The switch does not allow the `lockout-mac` command to be configured for a MAC address that is all zeros (000000-000000).

Config

CR_0000142393 Upgrading software from WB.15.11.xxxx to a newer version changes the `console inactivity-timer` from the configured value in minutes to that same value in seconds. Also, if the `console idle-timeout` value is set, after reboot the configured value is used for a console connection but not a TELNET connection.

CR_0000145562 A switch with an active radio port and configured with the command `lldp auto-provision radio-ports auto-vlan 2100` will move the radio ports into VLAN 2101 after a reboot. Similar errors occur for other `auto-vlan` numbers; after reboot the switch creates and uses a new VLAN instead of using the configured VLAN for radio ports.

Console

CR_0000140941 The `console inactivity-timer` setting is applied even if the user is typing on the console, when the console physical connection is to a stack member instead of the commander.

Counters

CR_0000141119 The output of `show ip counters` is incorrect when routing is enabled for IP, IPv6, or multicasts.

CR_0000142198 When a trunk configured for sFlow polling is simultaneously queried via SNMP, all counter values for the trunk are zero.

CR_0000143860 On a switch configured with rapid PVST and BPDU protection, the output of the command `show spanning-tree bpdu-protection` shows zero errant BPDUs received, even when the switch has disabled a port due to receiving a BPDU. This is a display issue only, both rapid PVST and BPDU protection function properly.

Crash

CR_0000142238 From the menu, after selecting "Status and Counters" and "Port Address Table" for an active port, the switch might reboot unexpectedly with a message similar to `Read Error Restr Mem Access HW Addr=0x2020201c IP=0x4ee7ce8 Task='mSess1' Task ID=0xe087cc0 fp: 0x06cefc48 sp:0x06cefc20 cpsr: 0x2000001f dfsr: 0x00000005`.

CR_0000143459 When a switch is added to a physical stack, if either the new switch or the stack (but not both) is running a version of software listed below, the stack might reboot unexpectedly with a message similar to `Software exception at proStackUtil.c:137 -- in 'mStackingCtrl', task ID = 0x3c940dc0`. The applicable software versions are KA.15.12.0012 (for 3800 switches), and WB.15.12.0012 and WB.15.12.0013 (for 2920 switches).

CR_0000144879 The switch might reboot unexpectedly in these situations:

1. The switch is running 15.08 or earlier software, is configured to drop frames that have a destination address of 01:00:0c:cc:cc:cd, and has PVST filtering or PVST protection enabled. Then the switch is updated to 15.09 or later software.
2. The switch is running 15.09 or later software, is configured to drop frames that have a destination address of 01:00:0c:cc:cc:cd, and then PVST filtering or PVST protection is enabled.

The switch reboots unexpectedly with a message similar to `Software exception at btflLearn.c:2616 -- in 'mLpmgrCtrl', task ID = 0xa98a9c0 -> Mac Table Error`.

CR_0000145024 With local MAC authentication enabled, issuing the `show run` command causes a small decrease in the switch's available memory. Over time if memory becomes depleted, the switch might reboot unexpectedly with a message similar to `Software exception at cli_show_config.c:667 -- in 'mSess6', task ID = 0xa965540`.

CR_0000146306 The switch uses TCP connections internally for inter-process communication. In a situation where an internal loopback TCP socket pair receives stimulus after an extended period of idle time, the switch might reboot unexpectedly with a message similar to `NMI event SW:IP=0x00e20c1c MSR:0x02029200 LR:0x00e077d0 cr: 0x44000400 sp:0x02b03c58 xer:0x00000000 Task='InetServer' Task ID=0xab31000`.

Display Issue

CR_0000140830 When `terminal length` is changed from the default of 24, the config file display is truncated, and the outputs of `show logging` and `show interfaces` might be interleaved in the output of `show tech all`.

Fastboot

CR_0000141043 If the fastboot setting is changed by the user, and the switch experiences a power interruption or reboot while the new setting is being written to flash, upon bootup the MAC address on a switch or stack member might be erased. Note that this fix has a side effect: If the fastboot setting is changed by the user and the switch software is downgraded (changed to an earlier version), upon bootup the fastboot setting might revert to what it was before the user-initiated change, even though the switch reports that it has been changed. Workaround: Change the fastboot setting twice - first change it back to what it was before the user-initiated change, then change fastboot to the desired setting.

IGMP

CR_0000138408 Joins sent by clients in response to a Group Specific Query are not forwarded by the Querier, causing the clients to lose the stream.

CR_0000140514 After disabling IGMP forwarding on a port, multicast traffic incorrectly continues to flow from that port.

IP Phones

CR_0000147849 Alcatel phones might reboot unexpectedly when connected to a switch configured for IP phones to use MAC authentication and for PCs to use 802.1X authentication.

Logging

CR_0000143781 When some events occur on a stack, if the event happens on the Standby switch, the switch fails to generate an event log entry, a syslog entry, or an SNMP trap. Examples are disconnecting the RPS cable, and removing a module from the back of the switch.

CR_0000144926 When some events occur on a stack, if the event happens on the Standby switch, the switch fails to generate an event log entry, a syslog entry, or an SNMP trap. This fix adds additional events to those included in the original Logging fix (CR_0000143781), also in 15.15 software.

Meshing

CR_0000143068 Multicast traffic and unicast traffic with unknown destination addresses are not routed over the mesh.

MSTP

CR_0000134194 With Spanning Tree enabled, configuring a live port as an `admin-edge-port` causes the output of `show run` to display a fixed path-cost for that port in the IST (for example, `spanning-tree instance ist 5 path-cost 20000`). Note that this is a display issue only, the switch uses the automatic path-cost based on the link speed.

Multicast

CR_0000138817 When a multicast stream is sent to a reserved multicast address, a General Query might not be forwarded by the switch, causing clients to be dropped from the multicast stream.

RADIUS

CR_0000138258 In some situations, the switch response to "Change of Authorization" and "Disconnect Messages" from the RADIUS server is sent from an incorrect source IP address, which the RADIUS server therefore ignores.

Spanning Tree

CR_0000143817 With a switch configured for MSTP, if the spanning tree mode is changed to `force-version rstp-operation` and then a second management module (or stack member) is inserted, the switch might reboot unexpectedly with a message similar to `Health Monitor:`

```
Read Error Restr Mem Access HW Addr=0xe59ff10c IP=0x779004c
Task='mMstpCtrl' Task ID=0x13af9740 fp: 0x0d372620 sp:0x0d372604 cpsr:
0x6000001f.
```

Transceivers

CR_0000143444 Software does not allow the dual-speed J8177C Gigabit-copper transceiver to be configured for 100 Mbps operation, responding with a message such as `Value auto-100 is not applicable to port A21`. This is the same fix as CR_0000132781 in 15.13.0003, which was inadvertently removed by CR_0000126473 in 15.13.0004 software.

Version WB.15.14.0005

WB.15.14.0005 was never built.

Version WB.15.14.0004

Crash

CR_0000143459 When a switch is added to a physical stack, if either the new switch or the stack (but not both) is running a version of software listed below, the stack might reboot unexpectedly with a message similar to `Software exception at proStackUtil.c:137 -- in 'mStackingCtrl', task ID = 0x3c940dc0`. The applicable software versions are KA.15.12.0012 (for 3800 switches), and WB.15.12.0012 and WB.15.12.0013 (for 2920 switches).

Logging

CR_0000143781 When some events occur on a stack, if the event happens on the Standby switch, the switch fails to generate an event log entry, a syslog entry, or an SNMP trap. Examples are disconnecting the RPS cable, and removing a module from the back of the switch.

CR_0000144926 When some events occur on a stack, if the event happens on the Standby switch, the switch fails to generate an event log entry, a syslog entry, or an SNMP trap. This fix adds additional events to those included in the original Logging fix (CR_0000143781).

RADIUS

CR_0000138258 In some situations, the switch response to "Change of Authorization" and "Disconnect Messages" from the RADIUS server is sent from an incorrect source IP address, which the RADIUS server therefore ignores.

Spanning Tree

CR_0000141851 When setting up a spanning-tree path-cost of 1, the port remains disabled instead of switching to blocking when plugged in. This happens when one copper and one fiber cable connect two modules. The path-cost of 2 forwards successfully, but the path-cost 1 remains disabled. This happens for both the copper and the xcvr.

Version WB.15.14.0003

WB.15.14.0003 was never built.

Version WB.15.14.0002

802.1X

CR_0000134257 After 802.1X frame counters reach a maximum value of 2,147,483,647, the counters are displayed as negative values that become smaller until they reach zero. When the counters reach zero, they begin incrementing again.

Authentication

CR_0000134114 With both 802.1X and MAC Authentication configured on a port, it is possible for an already-authenticated client to be erroneously moved to the unauthenticated VLAN.

CLI

CR_0000136428 CLI output for `show ip igmp vlan x conf` displays a plus sign under the Interconnect Trunk column heading, and nothing (blank) under the Port column heading.

CR_0000137287 The output of `show run vlan <VLAN_ID>` omits the `no` in the configuration entry `no ip igmp fastleave`. Note that the output of `show run` gives correct information.

CR_0000138493 The error message is not clear when the user attempts to create an overlapping network on a switch. This fix was inadvertently omitted from the original WB.15.14.0002 fix list.

Config

CR_0000131054 Setting an operator or manager password on the switch causes four features to be disabled: auto run, DHCP-based config file download from an external tftp server, DHCP-based software image download from an external tftp server, and tftp server functionality within the switch. With this fix, more accurate messages are sent regarding the specific features that are disabled by setting the operator or manager password.

CR_0000135481 After boot, a config file that has a trap destination community name with an open parenthesis "(" or a close parenthesis ")" cannot be downloaded to the switch.

CR_0000138447 After a switch software update, SNMP community access privileges are incorrectly changed by the switch. The output of `show snmp-server` and the output of a "walkmib" command give different results, and neither output represents how the switch actually behaves for Manager or Operator access. This issue was introduced with CR_0000122623; if the access settings were configured on a switch without the CR_0000122623 fix, after updating to software with the CR_0000122623 fix the settings are changed.

CR_0000139251 When a configuration file is downloaded to the switch, a default SNMPv3 user named "initial" is created on the switch even though it is not in the config file.

Crash

CR_0000115372 The switch might reboot unexpectedly with a message similar to `NMI event SW:IP=0x00000000 MSR:0x00000000 LR:0x00000000 cr: 0x00000000 sp:0x00000000 xer:0x00000000 Task='InetServer' Task ID=0xaad3000`.

CR_0000127791 In a rare situation the switch might reboot unexpectedly with a message similar to `Software exception at rt_table.c:4453 -- in 'eRouteCtrl', task ID = 0xa9c4c00 -> Routing Stack: Assert Failed`. This improves the original Crash fix (CR_0000120116).

CR_0000137288 With SNTP configured, in a rare situation after a time update the switch might reboot unexpectedly with a message similar to `Health Monitor: Invalid Instr Misaligned Mem Access HW Addr=0x31352e30 IP=0x31352e30 Task='mDebugCtrl' Task ID=0x3c9558c0 sp:0x11f92cd0 lr:0x31352e31 msr: 0x02029200 xer: 0x00000000 cr: 0x28000800`.

CR_0000138879 After boot, a switch that has a syslog server and an IPv6 address configured might become unresponsive to management, and after a period of time the switch might reboot repeatedly with a message similar to `NMI event SW:IP=0x001517d4 MSR:0x02029200 LR:0x0015178c cr: 0x28000400 sp:0x03aae0e0 xer:0x00000000 Task='mDebugCtrl' Task ID=0xa9f8000`.

DHCP

CR_0000128754 If the switch is a DHCP client and the DHCP reply contains option 43 with sub-option codes that conflict with RFC 2132 options, the switch might use incorrect settings such as an incorrect subnet mask.

CR_0000137877 A switch acting as a DHCP relay agent sends two DHCP packets, one of which incorrectly has the source MAC address of the client instead of the switch.

Event Log

CR_0000127436 After the switch uptime reaches 497 days, the timestamp entries in the event log become erratic with gaps of several hours or days. In some cases the timestamps revert to previous months and years, even though SNTP updates with those wrong timestamps report the correct date and time.

GVRP

CR_0000130090 After rebooting the switch, the configuration `unknown-vlans disable` does not work on trunks.

ICMP

CR_0000134682 The switch does not log an unsolicited ICMP reply unless it has first pinged some (any) IP address. Also, unsolicited ICMP reply log messages are sometimes associated with the `DEFAULT_VLAN` instead of the VLAN of the incoming unsolicited ICMP reply.

IGMP

CR_0000132149 Although the RFC requires that the switch with the lowest IP address becomes querier, a switch that is acting as querier stops being querier when it receives a query from a switch with a higher IP address.

CR_0000134412 The switch sends an IGMP General Query with an incorrect layer 2 destination address.

CR_0000135527 A non-querier switch that receives a Join from the querier fails to send further Joins to the querier, resulting in loss of multicast traffic.

Jumbo Frames

CR_0000137961 When jumbo frames are enabled on any VLAN, OSPF fails to establish an adjacency after a switch reboot, and RIP updates might not be accepted by the router.

Link

CR_0000137549 Gigabit fiber transceivers operate in auto-negotiation mode even if the port is configured for 1000 Mbps full-duplex operation (`speed-duplex 1000-full`). If both sides of the link were configured as 1000-full, the link will go down after the switch at one side of the link is updated with affected software. This issue was introduced in software version 15.12.0006.

Loop Protection

CR_0000127150 Loop protection fails to detect a loop on a port configured for 802.1X authentication, if 802.1X is not enabled globally.

MAC Authentication

CR_0000129991 MAC Authentication fails when the `peap-mschapv2` parameter is included in the `aaa authentication` CLI command.

OpenFlow

CR_0000134471 OpenFlow flows are not programmed correctly when RPVST+ is disabled on the OpenFlow member VLAN.

Passwords

CR_0000130921 If the switch is configured with a username and password, changing the password causes the username to also change. The username is changed to the default "manager" or "operator", depending which password is changed.

Policy Based Routing

CR_0000134936 The `show statistics policy` counter is not reset by the `clear statistics policy` command.

RADIUS Accounting

CR_0000137793 An interim-update status request generates incorrect accounting information in the RADIUS server. This issue was introduced with CR_0000123330.

Routing

CR_0000123230 The switch does not forward traffic to a host that has a static route configured with a 32-bit subnet mask. Traces show that the switch never sends an ARP request for that host.

sFlow

CR_0000128439 When an sFlow-sampled inbound packet is to be routed, the sFlow data gives the wrong output port on the switch.

CR_0000134427 sFlow sampling of multicast packets sometimes results in duplicate packets that can cause pixelation of video or other degradation of the multicast stream.

SNMP

CR_0000122623 After rebooting a switch configured for SNMP with the parameters `operator unrestricted`, the switch does not allow the user to set any read/write MIB objects.

CR_0000135477 A trap from an undocumented OID can be triggered under certain conditions. With this fix, OID 1.3.6.1.4.1.11.2.3.7.11.107.0.2 has been added to the MIB.

SSL

CR_0000127972 A self-signed certificate cannot use a common name (CN) longer than 40 characters. With this fix, the limit is 90 characters.

TFTP

CR_0000123187 TFTP file transfers initiated via TELNET or SSH fail, if the console inactivity-timer setting causes the TELNET or SSH session to end during the transfer. This issue does not affect file transfers initiated via the console or via SFTP.

Transceivers

CR_0000132781 Software does not allow the dual-speed J8177C Gigabit-copper transceiver to be configured for 100 Mbps operation, responding with a message such as `Value auto-100 is not applicable to port A21`.

CR_0000133023 100-Megabit transceivers might have one or more of these symptoms:

1. Link LED is lit but link is down
2. No Link after the transceiver is hot-swapped
3. Transceiver fails self test

Trunking

CR_0000126473 The switch does not allow a static LACP trunk to be configured as active or passive. This fix adds a new interface command: `lacp static [active | passive]`.

Uplink Failure Detection

CR_0000127868 On a switch that is configured for uplink failure detection where the link to monitor (LtM) or link to disable (LtD) is an LACP trunk, after reboot the link to monitor is listed as down in the output of `show uplink-failure-detection`, and the link to disable is taken down by the switch.

Web Management

CR_0000135883 The "Rx Errors" column is missing from the Web user interface.

CR_0000137792 A self-signed SSL certificate generated via the Web interface cannot use a common name (CNAME) longer than 40 characters. With this fix, the limit is 90 characters.

Upgrade information

Upgrading restrictions and guidelines

WB.15.14.0012 uses BootROM WB.15.05. If your switch has an older version of BootROM, the BootROM will be updated with this version of software.

For more information about BootROM, see the *HP Switch Software Management and Configuration Guide* for your switch.

-
- ⓘ **IMPORTANT:** During the software update, the switch will automatically boot twice. The switch will update the primary BootROM, then reboot, and then update the secondary BootROM. After the switch flash memory is updated and the final boot is initiated, no additional user intervention is needed. Do not interrupt power to the switch during this important update.
-

Contacting HP

For additional information or assistance, contact HP Networking Support:

www.hp.com/networking/support

Before contacting HP, collect the following information:

- Product model names and numbers
- Technical support registration number (if applicable)
- Product serial numbers
- Error messages
- Operating system type and revision level
- Detailed questions

HP security policy

A Security Bulletin is the first published notification of security vulnerabilities and is the only communication vehicle for security vulnerabilities.

- Fixes for security vulnerabilities are not documented in manuals, release notes, or other forms of product documentation.
- A Security Bulletin is released when all vulnerable products still in support life have publicly available images that contain the fix for the security vulnerability.

To find security bulletins:

1. Go to the HP Support Center website at www.hp.com/go/hpsc.
2. Enter your product name or number and click **Go**.
3. Select your product from the list of results.
4. Click the **Top issues & solutions** tab.
5. Click the **Advisories, bulletins & notices** link.

To initiate a subscription to receive future HP Security Bulletin alerts via email, sign up at:

www4.hp.com/signup_alerts

Related information

Documents

To find related documents, see the HP Support Center website:

www.hp.com/support/manuals

- Enter your product name or number and click **Go**. If necessary, select your product from the resulting list.
- For a complete list of acronyms and their definitions, see *HP FlexNetwork Technology Acronyms*.

Related documents

The following documents provide related information:

- *HP Switch Software Basic Operation Guide*
- *HP Switch Software Feature Index — Extended*

Websites

- Official HP Home page: www.hp.com
- HP Networking: www.hp.com/go/networking
- HP product manuals: www.hp.com/support/manuals
- HP download drivers and software: www.hp.com/networking/software
- HP software depot: www.software.hp.com
- HP education services: www.hp.com/learn

Documentation feedback

HP is committed to providing documentation that meets your needs. To help us improve the documentation, send any errors, suggestions, or comments to Documentation Feedback (docsfeedback@hp.com). Include the document title and part number, version number, or the URL when submitting your feedback.